

ARENAC COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

ARENAC

(County)

Located In:

Corner Code

Page 1 of 1  
ROSE SMITH

LC 2/ 138  
1P

ARENAC CO. REG. OF DEEDS  
RS Rec. Date 12/23/97 Time 11:43  
RECORDING FEES: 9.00

1. Public Land Survey

T18N R4E

T18N R5E

T R

T R

S T R

2. Property Controlling  
in Section

S

T R

S

T R

3. Miscellaneous  
Property in Sec.

S

T R

S

T R

M-9

A-9

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

I, MICHAEL J. MACDONALD, in a field survey on OCTOBER 23, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-9

1. ORIGINAL POST SET BY L. CLASON D.S. 1837  
HEMLOCK 16" N 23°E 14 LINKS  
HEMLOCK 15" N 26°W 33 LINKS

2. SPICER ENGINEERING NOTES, 1968, FOUND 3/4" PIPE 10" BELOW SURFACE IN CENTER GRAVEL SURFACE

3. SURVEY, L. 1, P. 4, DELAMATER, (1972) FND IRON  
NW 59.6' TO PP, NE 48.8 TO FENC POST

4. SURVEY, L. 1, P.219, MACDONALD, (1976) FND  
NW 59.6' TO PP, NE 48.8 TO FENCE POST, SOUTH 93' TO STUMP

5. SPICER NOTES, 1987, FOUND CORNER, 1.2' SOUTH, 4.6' WEST TO CORNER USED BY EDMANDS ENGINEERING

6. UNRECORDED SURVEY, JOHN MEYERS (#14099), SEPTEMBER 1995, FND CORNER PER SECTION BREAK NOTES

CORNER IS COMMON WITH A-9, T18N, R5E

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-9

SEARCHED THE APPARENT LOCATION OF THE CORNER AND FOUND A 3/4" PIPE, AND 1 1/4" PIPE. EXCAVATED BOTH POINTS. WHILE EXCAVATING THE 1 1/4", FOUND A WOOD POST 8" BELOW SURFACE NEXT TO 1 1/4" PIPE. ALSO FOUND POTTERY AND GLASS NEXT TO 1 1/4" PIPE. UNDER THE 3/4" PIPE FOUND 3 LARGE ROCKS. 1 1/4" PIPE FITS ONE EXISTING WITNESS ( NW 59.5' R. TO PP 59.8' M) FROM WADE TRIM WITNESS SHEET AND SURVEYS RECORDED IN L. 1, P. 4 AND L. 1, P. 219. JOHN MEYERS USED THE 3/4" PIPE IN AN UNRECORDED SURVEY (1995) PER THE DISTANCE TO B-9 T18N, R5E. FROM THE SECTION BREAK NOTES. THE 1 1/4" PIPE WAS ACCEPTED AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-9

REPLACED 1 1/4" PIPE WITH 5/8"x 24" LONG REROD WITH ARENAC CO. REMONUMENTATION CAP WITH 1/8" DRILL HOLE.


N 30° E 66.59' SET N/T SE FACE 12" ELM  
N 45° W 59.98' FND N/T NE FACE UP  
N 35° W 34.43' S. FACE ST. SIGN POST  
S 70° E 54.70' SET N/T EAST FACE 8" ELM  
EAST 4.90' TO 3/4" PIPE

Signed by

Michael J. MacDonald

Surveyor's Michigan License No. 22438


FIELD BOOK 2, PAGE 55

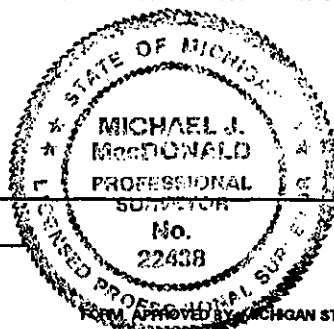

SURVEY &  
REMONUMENTATION

MAR 05 1998

SECTION

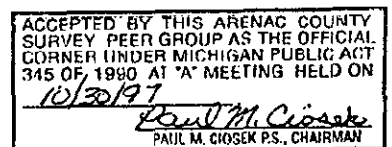

Date 10 Dec 97