

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga

(County)

Located in:

Corner Code #

1. Public Land Survey

T48N R 32W K8
T R
T R
T R

2. Property Controlling
in Section

S 11 T48N R 32W 15
S T R

3. Miscellaneous
Property in Sec.

S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat

5. Private Claims

Jun 04 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(K8) Quarter corner common to Sections 23-24. Reestablished by proportionate measurement in 1971 by A.O.Enger RLS. 1"IDx36" iron pipe with 4" aluminum cap. W.Birch 16 S65E 2.2', R.Maple 9 N04W 36.3'.
(15-Sec. 11) West 1/16 corner between Sections 11 and 14. Established in 1970 by A.O.Enger RLS midway and on line between Section and 1/4 corners 19.933 ch. west and east. 1"IDx36" iron pipe with 4" aluminum cap. B.Spruce 5 N40W 36.6', B.Spruce 5 S30E 18.5'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K8) Recovered the 1971 monument as described, in good condition, and at record bearing and distance from the 1971 NBTs. The W.Birch is now a cut stump with a small part of the lower blaze visible. The Maple, now 12" DBH, is in good condition with scribing visible on the lower blaze.
(15-Sec. 11) Recovered the 1970 monument, in good condition, and at record bearing and distance from the remains of the 1970 NBTs. The B.Spruce SE is a 12' high stub with scribing visible. The B.Spruce NW is a stump with notch and scribing visible. Left the monument in place and made new accessories.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K8) Found 1" ID iron pipe with 4" alum MDOC cap. Blazed and scribed:
4" Sugar N57E 3.3' 1/4S NBT
5" Sugar S04W 6.4' do
7" Maple N60W 9.9' do
12" Maple N01E 36.0' (1971 NBT)
Bearings are magnetic. Distances are to notch in lower blaze.
(15) Found 1" ID iron pipe with 4" aluminum MDOC cap. Blazed and scribed:
6" Tamarack S20E 30.8' 1/16S BT
7" Tamarack N40W 43.5' do
6" Tamarack N13W 37.8' do
8" Tamarack N48E 13.6' do
Sq'd tamarack post adjacent. Bearings are magnetic. Distances are to notch in lower blaze. C/L RR tracks bear S35E apx. 75 ft.

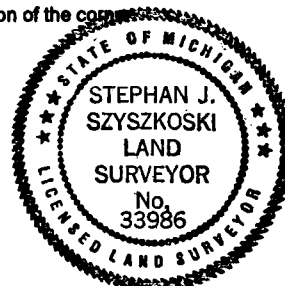

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 8/15/01

For the Michigan Department of Natural Resources - Forest Management Division