

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga
(County)

Located In:

Corner Code #

1. Public Land Survey

T 53N R 30W MC E. of B13

T R
T R
T R
T R

2. Property Controlling in Section

S 31 T 53N R 30W 4

3. Miscellaneous Property in Sec.

S T R
S T R
S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

4 Jan 03 2002
MC Nov 29 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(MC E. of B13) Witness corner to the Meander Corner between Section 31 T53N-R30W and Section 6 T52N-R30W. Monumented in 1973 by A.O. Enger RLS and described in Liber 1 of LCRCs, Pages 141-142, Baraga County Records. 1"IDx36" Iron pipe with 4" aluminum cap. Cedar 16 N21W 35.1', Cedar 10 N67 1/2W 67.1'.
(4-Sec. 31) Northwest 1/16 corner, Section 31. Not established in the original survey.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(MC E. of B13) Recovered the 1973 monument as described, in good condition, and at record bearing and distance from the 1973 accessories. The NBT Cedar 10 is dead and down. The Cedar 16 is in good condition with scribing visible. Accepted the monument as a careful and faithful reestablishment of the Section line between Sections 31 and 6.
(4-Sec. 31) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(MC) Found 1"ID 1. pipe with 4" alum. MDOC cap. Blazed and scribed:
16" W. Pine S67E 60.0' MC NBT
9" Sugar S50W 44.8' do
11" Y. Birch N77W 56.8' do
the 1973 wit:
18" Cedar N19W 35.0' do
Squared cedar post adjacent. Bearings are magnetic. Distances are to notch in lower blaze.

(4) Set 1"IDx32" 1. pipe with 4" alum. MDNR cap. Blazed and scribed:
6" Cedar N21E 77.4' 1/16S 8T
8" Maple N40E 49.3' do
11" Maple N55W 43.6' do
12" 8. Ash N09W 68.1' do
Squared a 4" Maple S22W 1.3' to center. Bearings are magnetic. Distances are to notch in lower blaze.

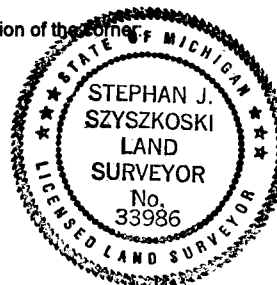

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 3/19/02

For the Michigan Department of Natural Resources - Office of Property Management

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1985