

Chippewa Co.

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

4 Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>42</u> N. <u>2</u> E. <u>W.</u> S. <u>R.</u>	E-11, E-9, G-11, F-11
2. PROPERTY CONTROLL- ING IN SECTION_____	T. _____ N. _____ E. _____ S. _____ R. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ N. _____ E. _____ S. _____ R. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-3 & 8-7, 19 79, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by John Mullett, D.S. in 1845. Bearings were:

- E-11 Sec. Cor. 28-29-32-33, Aspen 8", S44°W, 9 lks. & Spruce 10", N36°E, 19 lks.
 E-9 Sec. Cor. 20-21-28-29, Spruce 8", N36°E, 17 lks. & Cedar 10", N81°W, 20 lks.
 G-11 Sec. Cor. 27-28-33-34, Sugar 16", S78°W, 17 lks. & Cedar 14", N62°E, 33 lks.
 F-11 $\frac{1}{4}$ Cor. bet. Sec's. 28-33, Aspen 8", N76°E, 13 lks. & Aspen 5", N85°W, 10 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- E-11 Corner re-established by Double Prop. Measure from corners; 1 mile South, 1 mile West, $1\frac{1}{2}$ miles East and to streams, $1\frac{1}{4}$ miles North. Found a one wire fence corner 122' West and 45' North.
 E-9 Corner re-established by Double Prop. Measure from corners; 2 miles South, 1 mile West, 2 miles East and streams to North.
 G-11 Restored corner by Double Prop. Measure from corners in all four directions. Found the original corner, $\frac{1}{2}$ mile West of this corner. Found $\frac{1}{2}$ " iron pipe set by R. Larson, 258.2' West and 17.8' South of our Sec. Cor. location.
 F-11 Restored corner midway and on line bet. two section corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners. New Bearings are:


- E-11 16" W. Pine, S7°W, 18.3' & 7" W. Pine, N62°W, 34.0' & 7" Cedar, N25°E, 40.3'.
 E-9 16" S. Maple, S25°W, 13.1' & 12" S. Maple, N20°E, 21.1' & 8" S. Maple, S88°E, 35.1'.
 G-11 10" H. Maple, N78°W, 14.8' & 8" H. Maple, N20°E, 28.4' & 6" H. Maple, S68°W, 18.8'.
 F-11 8" H. Maple, S73°E, 23.2' & 8" H. Maple, N30°E, 24.0' & 8" H. Maple, N50°W, 12.1'.

SIGNED BY


 Billy D. Buckler

DATE 9-21-79

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

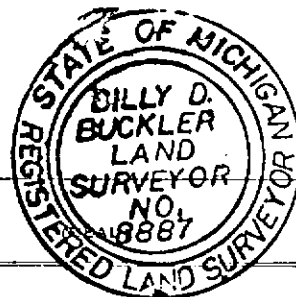

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____

CHIEF OF SURVEY PARTY

DATE _____

APPROVED AND SIGNED BY _____

MICHIGAN REGISTERED LAND SURVEYOR

DATE _____

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____