

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Dickinson	Located In:	Corner Code #
(County)		
NORWAY TOWNSHIP		
1. Public Land Survey	T 40N R 29W	C04
	T 40N R 29W	E04
	T	
2. Property Controlling in Section	S T	
	S T	
	S T	
3. Miscellaneous Property in Sec.	S T	
	S T	
	S T	
4. Lot No.	Recorded Plat	
5. Private Claims		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

8/06/2013AD
Jeremy J. Pipp, in a field survey on 8/07/2013AD do hereby state
that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2
above were in conformance with regulations and rules therefore as required in the current manual of survey
instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of
a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with
the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established,
re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(C04) Quarter corner common to Sections 7 and 8. 1849: James Mullett, DS. Set quarter
section post witnessed by Tamarack 8 N44E 15 links (9.90'), Tamarack 8 S55W 06 links
(3.96'). "

(E04) Quarter corner common to Sections 8 and 9. 1849: James Mullett, DS. Set Quarter
Section post witnessed by Hemlock 30 S14W 14 links (9.24'), Sugar 40 N13W 15 links
(9.90'). 1954: Michigan DNR (Billy Buckler PS#8887) Set 1" pipe with 4" Brass cap
witnessed by 14" Hemlock N47W 26 links (17.16'), 12" Hard Maple S52W 16 links (10.56').

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C04) No evidence of original survey. Several mounds in area no post points found. Found two
Cedars with old burned faces, leaning dead (N62E 7.6 ft & S67E 5.5ft from MPOL position) facing
each other and not of record. Corner position reestablished by single proportionate measurement
between the Northwest corner and the Southwest corner of Section 8. position is +/- 1 chain South
of creek (1.5 chains per GLO notes). Position is accepted as a careful and faithful
REESTABLISHMENT of the position of the original corner.

(E04) Accepted found MDNR Monument and remains of Two NBT's (Maple living, Hemlock dead
and down) as a careful and faithful PERPETUATION of the position of the original
corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C04) DNR monument
9" Cedar N52E 10.05' (1/4S,NBT)
6" Cedar S49E 24.20' (1/4S,NBT)
10" Cedar S68W 12.09' (1/4S,NBT)
6" ASH N39W 21.73' (1/4S,NBT)

All trees are blazed, scribed, painted,
and signed. Measurements are to nail in
side of tree, bearings are magnetic. A
carsonite post was set North 1.5 feet.

Signed by

Surveyor's Michigan License No.


(E04) DNR monument
6" Maple N60E 26.03' (1/4S,NBT)
7" Maple S37E 38.08' (1/4S,NBT)
EX 20" Maple S57W 10.44' (- , -)
8" Maple N35W 12.34' (1/4S,NBT)

All trees are blazed, scribed, painted,
and signed. Measurements are to nail in
side of tree, bearings are magnetic. A
carsonite post was set North 1.5 feet.

Date

August 26, 2013

For the Michigan Department of Natural Resources

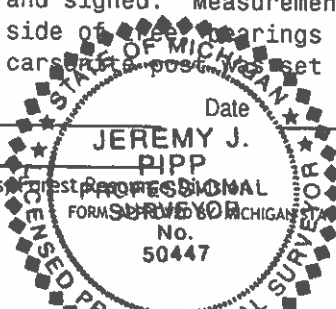

20269

20270

Revised May 14, 1975
Revised Jan., 1983
Revised Oct., 1995