

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Dickinson	Located In:	Corner Code #
(County)		
NORWAY TOWNSHIP		
1. Public Land Survey	T 40N R 29W	C06
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S 8 T 40N R 29W	12
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. , Recorded Plat		
5. Private Claims		

Register of Deeds Stamp & File Number

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

8/07/2013AD
8/07/2013AD
do hereby state
that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2
above were in conformance with regulations and rules therefore as required in the current manual of survey
instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of
a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with
the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established,
re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(C06) Quarter corner common to Sections 17 and 18. 1849: James Mullett, DS. Set
quarter section post witnessed by Hemlock 10 N27E 23 links (15.18'), Elm 4 S58W 08
links (5.28'). "

(12) Center-South One-Sixteenth corner of Section 8. Not set in original survey. Pipe
noted on 1949 Michigan DNR forestry notes; N-S 1/4 line run by Michigan DNR Survey crew
in 1958 and set chain marker noted at position.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C06) No evidence of original survey. Corner position reestablished by single
proportionate measurement between the Northwest corner and the Southwest corner of
Section 17. Position is +/- 1 chain North of foot of hill (1 chain per GLO notes).
Position is accepted as a careful and faithful REESTABLISHMENT of the position of the
original corner.

(12) Corner position established mid-point and on-line between the Center One-Quarter
corner and the South One-Quarter corner of Section 8. Found Pipe (South 3.58 feet from
calculated location) not accepted, because position was mostly established at an
approximate location without a section breakdown.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


(C06) DNR monument
4" Elm N26E 16.33' (1/4S,NBT)
6" Elm S43E 3.36' (1/4S,NBT)
5" Cherry S30W 27.66' (1/4S,NBT)
4" Elm N40W 12.76' (1/4S,NBT)

All trees are blazed, scribed, painted,
and signed. Measurements are to nail in
side of tree, bearings are magnetic. A
carsonite post was set West 1.5 feet.

Signed by Jeremy J. Pipp
Surveyor's Michigan License No. 50447

(12) DNR monument
7" Cedar N34E 13.03' (1/16S,BT)
5" Cedar S58E 3.65' (1/16S,BT)
5" Cedar S23W 24.94' (1/16S,BT)
6" ASH N64W 13.89' (1/16S,BT)

All trees are blazed, scribed, and
painted. Measurements are to nail in
side of tree, bearings are magnetic.

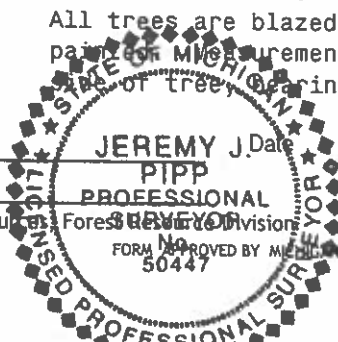

August 26, 2013

For the Michigan Department of Natural Resources Forest Service Division

20272

20271

Revised May 14, 1975
Revised Jan., 1983
Revised Oct., 1995