

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Dickinson</u>	Located in:	Corner Code #
(County)		
1. Public Land Survey	T <u>40NR</u> <u>29W</u>	<u>H1</u>
	T <u>40NR</u> <u>29W</u>	<u>I5</u>
	T <u> </u> <u> </u>	<u> </u>
	T <u> </u> <u> </u>	<u> </u>
2. Property Controlling	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
 5. Private Claims

Aug 14 2000

I, Stephan J. Szyszkoski, in a field survey on , 19 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(H1) North Quarter corner of Section 3. Not established in the original survey. Found no subsequent record.
 (I5) Corner common to Sections 10-11-14-15. From the original record by James Mullett, DS, 1949: North between 14 & 15...79.00 to foot 10 feet and ascend to post. 80.00 Set post corner Secs. 10,11,14&15. Cedar 12 S65E 25, Birch 10 S35W 22. East random btwn 11&14...1.00 Descend 12 feet from post. 1.50 Begin to ascend, 2.5 Summit 45 feet and descend. East random btwn 10&15...72.00 Summit 80 feet and descend. 79.50 Brook 03 rapid C SW at foot 80 feet and ascend 10 feet to post. 80.08 Intersected N&S line 10 links S of post. North btwn 10&11... .50 Foot of rock 12 feet. 1.00 Stream 02 rapid C SSW and begin to ascend.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(H1) Established the corner on the 4th Correction Line, a line of mean true bearing between monumented adjacent standard corners L13 and M13 of T41N-R29W, and equidistant between closing corner monuments 2652.57' east and west of this position.
 (I5) The original monument was not recovered. Remonumented the corner at record bearing and distance from the remains of probable bearing tree cedar, now a rotting stump with no marks visible, and in accord with the topographic calls noted above. There was no sign of the Birch 08T.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H1) Set 1" ID iron pipe with 4" aluminum MDNR cap. Blazed and scribed:	(I5) Set 1" ID iron pipe with 4" aluminum MDNR cap made firm in a rock mound 2.5' diameter. Blazed and scribed:
6" W.Ash N23E 44.5' "1/4S 8T"	11" Aspen S06W 6.1' "S15 N8T"
4" W.Spruce N27E 48.1' do	9" Y.Birch S74W 19.0' do
5" Aspen S51E 22.4' do	8" Cedar N69W 18.0' "S10 N8T"
6" Aspen S40W 18.3' do	8" Y.Birch N19W 27.5' do

Bearings are magnetic. Distances to notch in lower blaze.

Bearings are magnetic. Distances to notch in lower blaze. Placed sq'd cedar post adjacent.

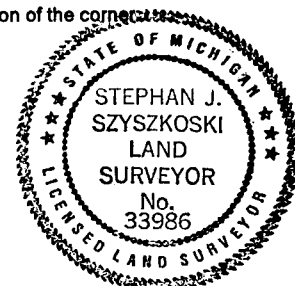

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 1/16/01

For the Michigan Department of Natural Resources - Forest Management Division