

# SURVEY & REMONUMENTATION

MAR 03 1998

## LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1997 DEC 10 PM 3:54

### SECTION

For corners in

Dickinson (County)

Located In:

Corner Code #

Breitung Twp.

1. Public Land Survey T 40N R 30W M.C. 26/27  
T R S. of T-9  
T R Other # 001  
T R M.C. 26/27
2. Property Controlling S T R N. of T-11  
in Section S T R #006
3. Miscellaneous S T R  
Property in Section S T R

4. Lot No. , Recorded Plat
5. Private Claims

REGISTER OF DEEDS  
DICKINSON COUNTY  
RON HOFFMAN

Register of Deeds Stamp & File Number

I, Robert F. Perkins, in a field survey on Oct. 29, 1997  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE:** Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

#### A. Description of original monument and accessories and/or subsequent restoration:

NORTH MEANDER CORNER 27/26  
Post by James H. Mullett, D.S. 1849  
Original Bearing Trees  
Tamarack 10" N41°W 52 Lks.  
Tamarack 6" N36°E 31 Lks.  
V110°W

SOUTH MEANDER CORNER 27/26  
Post by James H. Mullett, D.S. 1849  
Original Bearing Trees  
Birch 8" S½°E 06 Lks.  
Birch 8" N89°W

ADDED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 346 OF 1990 AT A MEETING HELD ON

12-9-97  
R.F.P.

COUNTY REPRESENTATIVE

#### B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

N-M.C. 27/26  
No Evidence of Original Corner or Accessories Found.  
Lake Level appears to have been raised subsequent to Original Survey. G.L.O. Notes place M.C. 1815' South of Section Corner. Present Lake is ± 1600' South. Found Iron Pipe (N.1/16) Corner at old Fence Corner 1406.57' South of Section Corner. Fence continues South to Water.

S-M.C. 27/26  
No Evidence of Original Corner or Accessories Found.  
Lake Level appears to have been raised subsequent to Original Survey. G.L.O. Calls along this do not appear reliable.

#### C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

N-M.C. 27/26  
Set 2½" Stamped D.C. Remon. Corner in Line with 1/16 Corner and Section Corner to North (± 1.5' East of Old Fence).  
New Witnesses:  
Spruce 6" S88°E (M.B.) 15.90' Nail/Tag  
Fir 3" N47°E (M.B.) 44.07' Nail/Tag  
Cedar 16" S85°E (M.B.) 40.92' Nail/Tag  
Aspen 8" N30°E (M.B.) 32.32' Nail/Tag


S-M.C. 27/26  
Set 2½" Stamped D.C. Remon. Corner at Lake Shore 890.95' Due North of Section Corner 26-27-34-35.  
New Witnesses:  
Cedar 8" S50°W(M.B.) 85.4' Nail/Tag  
Fir 5" S87°W(M.B.) 95.25' Nail/Tag  
Dbl. 4" Maple S46°E(M.B.) 33.00' Nail/Tag  
X on 4' Boulder S62°W(M.B.) 13.00'  
± 20' South to Centerline Steel Tower Line.

Signed by

Robert F. Perkins

Date Nov. 26, 1997

Surveyor's Michigan License No. 12027

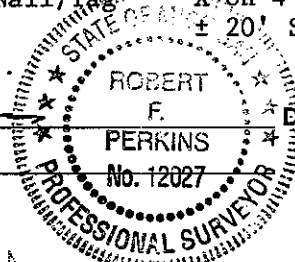

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

LIBER 002 PAGE 337