

SURVEY & REMONUMENTATION

MAR 03 1998

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1997 DEC 10 PM 3:54

For corners in **SECTION**

Dickinson (County)

Located In:

Corner Code #

Breitung Twp.

1. Public Land Survey T40N R 30W M.C. ²⁵/₃₆
T R W. of L-11
T R Other # #003
T R M.C. 35/36
2. Property Controlling in Section S T R N. of K-12
S T R #004
3. Miscellaneous S T R
Property in Section S T R

REGISTER OF DEEDS
DICKINSON COUNTY
RONALD L. ...

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, Robert F. Perkins, in a field survey on Oct. 29, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

²⁵/₃₆
MEANDER CORNER
Post by James H. Mullett, D.S. 1849
Original Bearing Trees
Cedar 4" N50°E 13 Lks.
Tamarack 10" S70°E 25 Lks.

MEANDER CORNER 35/36
Post by James H. Mullett, D.S. 1849
Original Bearing Trees
Birch 6" S7°E 32 Lks.
Tamarack 8" S28°W 33 Lks.

ACCEPTED BY THE DICKINSON
SURVEY PEER GROUP AS THE
CORNER UNDER MICHIGAN PUBL
845 OF 1990 AT A MEETING H...
12-9-97

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

²⁵/₃₆
M.C. 36
No Evidence of Original Corner or Accessories Found.
It appears from the Remains of Trees in the Water that the Lake Level was raised at some time subsequent to the Original Survey, probably by the construction of the Outlet Control Structure. As a result the Original Meander Corners were Lost.
Corner Location Researched in 1996 Remon. Program.

M.C. 35/36
No Evidence of Original Corner or Accessories Found.
It appears from the Remains of Trees in the Water that the Lake Level was raised at some time subsequent to the Original Survey, probably by the construction of the Outlet Control Structure. As a result the Original Meander Corners were Lost.
Corner Location Researched in 1996 Remon. Program.

COUNTY REPRESENT.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

²⁵/₃₆
M.C. 36
Set 2 1/2" Stamped D.C. Remon. Corner 1232.00'
West of 1/4 Corner ²⁵/₃₆ on alignment of ancient fence line running West from 1/4 Corner and has a Bearing of S89°35'45"W.
New Witnesses:
Spruce 10" N75°E(M.B.) 2.25' Nail/Tag
Spruce 7" S36°E(M.B.) 19.38' Nail/Tag
Cedar 6" S32°W(M.B.) 17.47' Nail/Tag
Maple 4" N14°E(M.B.) 10.65' Nail/Tag

M.C. 35/36
Set 2 1/2" Stamped D.C. Remon. Corner 1291.80'
Due North of 1/4 Corner 35 and 36, 4' from High Water Mark.
New Witnesses:
Cedar 4" S37°E(M.B.) 10.68' Nail/Tag
Cedar 3" N46°W(M.B.) 7.76' Nail/Tag
Cedar 3" S03°E(M.B.) 37.22' Nail/Tag
Cedar 3" S38°W(M.B.) 31.88' Nail/Tag
Centerline dirt Road ± 16' South

Signed by Robert F. Perkins
Surveyor's Michigan License No. 12027

Date Nov. 26, 1997

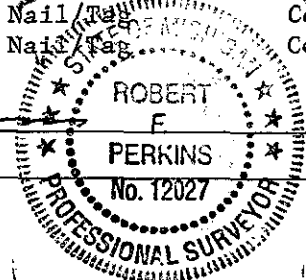

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN, 1963

LIBER 002 PAGE 338