

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Dickinson

(County)

Located in:

Corner Code #

1. Public Land Survey

T. 43N R. 28W I9
T. 43N R. 28W K9

2. Property Controlling in Section

S. T. R.
S. T. R.
S. T. R.
S. T. R.

3. Miscellaneous

Property in Sec.

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

K9 Jun 26 2001

I9 Jun 13 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

A. Description of original monument and accessories and/or subsequent restoration:

(I9) Corner common to Sections 22-23-26-27. Established in 1850 by John Burt: "...S6°W corrected between Secs 22&23...40.02 Set Cedar quarter Sec. post...80.04 Set post corner of sections 22,23,26,27. Wh. Pine 24 S43E 38, do 24 N62W 18". Old notes at Dickinson Co. Rd. Commission (ca. 1934?) state: "This corner was established by J.E. Gingras Sept. 1919. We found no bearing trees. Everything has been burned over and wash out as this corner is near the Ford river, and the overflow of said river has caused many of the trees to be moved from their original places". 1922 Map of the Proposed school site, Ralph MI (File B-16 No. 4 at DCRC) shows 1328.8' north to 1/16 cor., thence 1328.8' north to 1/4 22-23.

(K9) Corner common to Sections 23-24-25-26. Perpetuated in the original position and recorded by Dean C. DeLaMater in 1952. 1" Pipe with 4" brass cap. NBTs: 20" W.Pine N56E 68 links, 14" W.Pine S54W 59 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I9) The original post and accessories were not recovered. Found a 1.25" dia. axle shaft with old sq'd and scribed cedar post adjacent. Existing old fence intersection at 1/16 corner to north checks well for line and distance between this monument and monumented I8. Distance north to I8 from this mon. was found to be 2657.47', only 0.13' shorter than the 1922 plan noted above. I accepted the monument as the best available evidence of the position of the original corner. As few witnesses are available at this position, I note the distances to monumented 1/4 corners: 2652.90' West, 2633.70' East, 2651.18' South, and 2657.47' North.

(K9) Recovered the 1952 monument as described, in good condition, and at record bearing and distance from the rotting stump remains of the 1952 witness trees. The remains of the original BT W.Pine 20 S61W 46 links were also found at record bearing and distance.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


(I9) Found 1.25" dia. axle shaft.

Blazed and scribed a 15" Cedar S69E 102.1' (scribed S26 NBT). Placed a sq'd cedar post north, 1.1'. No other nearby witnesses available. Bearings magnetic. Dist. to notch in lower blaze of Cedar NBT.

(K9) Found 1" ID iron pipe with 4" brass

MI Dept. of Conservation cap. Blazed and scribed:

5" W.Pine N26W 47.2' "S23 NBT"
4" W.Spruce S68E 32.4' "S25 NBT"
5" W.Pine S12W 42.8' "S26 NBT"
5" W.Spruce S79W 41.3' "S26 NBT"
4' tall metal fnc post 0.8' northerly.
Placed sq'd cedar post 2' north.
Bearings are magnetic. Distances to notch in lower blaze of trees.

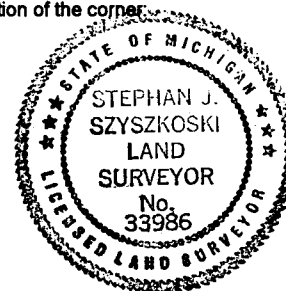

Signed by

Stephan J. Szyszkoski

Date

7/18/01

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division