LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Noughton	Located in:	Corner Code #	
(County)	Located III.	Collies Code #	
1. Public Land Survey	´ Τ <u>51</u> Ν ε Τ <u>51Ν</u> ε Τ <u> </u>	35M 16 35M 15	
Property Controlling in Section Miscellaneous Property in Sec.	T F S T F S T F S T F		


Register of Deeds Stamp & File Number

, Recorded Plat 4. Lot No. 5. Private Claims

Aug 04 1997

Stephan J. Szyszkoski , in a field survey on . do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

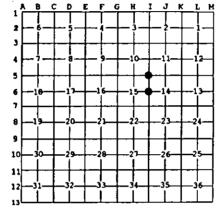

A. Description of original monument and accessories and/or subsequent restoration:
(16) Quarter corner comeon to Sections 14-15. Corner reestablished in 1958 by Billy D. Buckler, RLS: "Reestablished 1/4 corner midway and on line between two section corners...corner monument 1" pipe with 4" brass cap, witnesses to corner 12" hard maple NI7E 51 links, 14" Y. Birch \$680 102 links".

(IS) Corner common to Sections 10-11-14-15. Corner remonumented in 1958 from two original B.T.s by Billy D. Buckler, RLS. Corner monument: 1° pipe with 4° brass cap. Witnesses to corner: 12° soft maple \$29E 40 links, 14° cedar M36E 39 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(16) Found the 1958 monument as described, a 1" ID iron pipe capped with a 4" dia. brass MI Dept. of Conservation tablet, in good condition, and at record bearing and distance from the two 1958 MBTs. The maple is in good condition, the Y. Birch is down and rotten. Determined that the monument is about 16' Westerly of the straight line between adjacent section corners as they are now monumented. I accepted the monument, left it in placed, and marked three new mitnesses as described below. Corner remitnessed by B.Wheeler, Baraga District Office.

(15) Found the 1958 monument as described, a 1" dia. iron pipe capped with a 4" dia. brass MI Dept. of Conservation tablet, in good condition, and at record bearing and distance from the 1958 accessories. The maple is dead and down, the cedar is green but leaning with a broken top. Left the monument in place and marked three new witnesses as described below. Corner rewitnessed by B.Wheeler, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate jocating the position of (16) Found 1° pipe with 4° brass MI (15) Found 1° iron pipe with 4° brass Dept. of Conservation cap. Blazed and cap. Blazed and scribed the following new bearing trees: scribed the following: 10" Sugar \$79E 13.1' "1/45 HBT" 8" Y. Birch \$76E 16.0" \$14 H8T 14" Maple \$30M 21.9" "1/45 NBT" 8" Sugar \$80W 28.2" S15 NBT 8" Sugar N53N 31.2" "1/45 HBT" 5° Sugar #30# 11.2' "S10 MB7" The 1958 MBT 20" Sugar N19E 33.6' found The 1958 witness cedar 14" M46E 26.3". with old blazes. Bearings are magnetic. Placed a maple post adjacent. Bearings are magnetic. Distances to notch in Distances to notch in lower blaze. lower blaze.

STEPHAN J. SZYSZKOSKI LAND SURVEYOR

Surveyor's Michigan License No

33986

For the Michigan Department of Matural Resources - Forest Management Division