LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Houghton (County)	_ Located In:	Corner Code #	
1. Public Land Survey	T 52N R 35W	K1 (GCDB 600700)	
2. Property Controlling in Section	S T R S T R S T R		
3. Miscellaneous Property in Sec.	S T R S T R		
4. Lot No. 5. Private Claims	corded Plat		Register of Deeds Stamp & File Number
above were in conformance with	74, Michigan P.A. of 1970, the corner regulations and rules therefore as requ	uired in the current manual of survey	y ⁵
a Court of Law and /or that the o	Department of the Interior, Bureau of corner points mentioned in lines 3, 4 and of Land Surveyors or by a Decre vered, found as expressed below:	nd 5 above were in conformance with	h 7
NOTE: Not more than 2 corron this certificate.	ners, all in the same town and rang	ge, may be recorded	10 30 29 28 27 26 25 11 12 31 32 33 34 35 36

A. Description of original monument and accessories and/or subsequent restoration:


(K1) Closing Section corner common to Sections 1 & 2. 1846 - S.W.Higgins, Deputy, set post on Township line 06 links west of Standard Corner to Sections 35-36 T53N-R35W. Y.Birch 8" S15°W 12 links, Spruce 6" S14°E 10 links. Notes of P.A. & M.C. Larsen for Closing Cor. K1 of T52N-R35W: "1920 - Found old cedar post. 1958 - Set new post along side.". 1966 - Billy D. Buckler RLS: Replaced corner as set by M.C. Larsen, Hancock. Found no original witnesses. 1" pipe with 4" aluminum cap. 14" Cedar N50°E 31.7', 12" Cedar S85°W 31.5', 6" Soft Maple South 17.6'. The 1966 record erroneously describes the Closing Corner as being common to Standard Corner K13. According to the US survey, the Standard Corner is 06 links east of the Closing Corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(K1) The 1966 monument was not found and I suspect that, contrary to the record, it was never set. Found two rotted-off post points of different ages, at substantial record bearing and distance from the 1966 witnesses, all alive with overgrown blazes. Found a rotted Y.Birch stump S30°W 10 ft, possibly the remains of the BT Y.Birch 8" S15°W 12 links, but no marks found. Standard Corner for Sec. 35-36 T53N-R35W was remonumented 3.96' (06 links) east of K1 this date and that corner is in accord with possible BT Cedar N35W 37 links [described in T53N-R35W GLO notes]. Accepted the post points as the best available evidence of the position of the original corner and set a new monument as described below.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K1) Set 1"IDx28" I.pipe with 2" alum. MDNR cap. Set measuring nail with MDNR tag in the side of: 12" Cedar N55°E 32.0' old blazes (1966 wit. tree) 10" Maple S06°W 16.6' do do 15" Cedar N87°W 31.15' do do 10" Spruce S72°E 16.35' mrkd "S1 NBT" 1"ID I.pipe/MDNR cap at Stand.Cor. S87E 3.96' Set sq'd cedar post 1 ft. north. E= 7870556.157 N= 240950.515

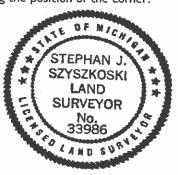

Bearings are magnetic. Coordinates are MCS83 in meters, NAD83(2011) Epoch 2010.00 datum. Coord. Ref.=NGS PID D08499: N= 221257.624 m. E= 7884435.169 m.

igned by	Jansylieli.	Date	11/04/2015	
urveyor's Michigan License No.	33986			