

2000 REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For Corners in

Huron  
(County)

Located in:

Corner Code #

STATE OF MICHIGAN  
HURON COUNTY  
RECORDED

29 NOV 2000 11:22 AM

FRANCES L. HOLDWICK  
REGISTER OF DEEDS

1. Public Land survey: Brookfield T 15\_N R 10\_E

T      R       
T      R       
T      R     

A-9

A-10

SURVEY &

REMONUMENTATION

2. Property Controlling  
in Section

S      T      R       
S      T      R     

3. Miscellaneous  
Property in Sec.

S      T      R       
S      T      R     

JAN 19 2001

Register of Deeds Stamp & File Number

4. Lot No.           , Recorded Plat           

5. Private Claims           

SECTION

I, James T. Meek, in a field survey on October 1, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expessed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
Original survey, West Bdy. T15NR10E, 1835, Harvey Parke D.S.

A-9 Corner of Sections 19, 30

Post

Cedar 16", N29°W, 41 links

Hemlock 8", S16°W, 15 links

County Surveyor's Record: 1/4" iron pin

Recorded Surveys: L3, P389 (Brown); L3, P690, P691 (Brown)

LCRC: none

A-10 West 1/4 Corner of Section 30

Post

B. Ash 16", N39°W, 7 links

B. Ash 16", S55°W, 33 links

County Surveyor's Record: 1/4" iron pin

Recorded Surveys: none

LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-9 Corner of Sections 19, 30

Found 1" iron in mon box

At intersection of Bay Port & McAlpin Roads

Accepted as the best available evidence of the original corner position.

A-10 West 1/4 Corner of Section 30

Found no evidence of the original corner position

Set 1/4" iron w/cap #39089 in mon box

At proportionate distance

Occupation lines bear East & West

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-9 Corner of Sections 19, 30

1" iron in mon box

From which:

Road sign post bears N60°E, 40.5'

Wood post bears S55°W, 46.6'

Road sign post bears S60°W, 33.0'

Tag in power pole bears N60°W, 36.1'

A-10, 1/4 Corner of Section 30 bears

S0°19'59"E, 2631.60'

A-8, 1/4 Corner of Section 19 bears

N0°02'59"E, 2632.40'

A-10 West 1/4 Corner of Section 30

1/4" iron w/cap #39089 in mon box

From which:

1/4" iron bears N45°E, 25.0'

1/4" iron bears S45°E, 25.0'

Tag in power pole bears S45°W, 56.05'

Metal post bears S85°W, 38.25'

A-11, Corner of Sections 30, 31 bears

S0°19'59"E, 2631.60'

A-9, Corner of Sections 19, 30 bears

N0°19'59"W, 2631.60'


Signed by

Surveyor's Michigan License No. 39089

Date

2, 2000

APPROVED AT PEER BOARD MEETING 11-02-00 RLB

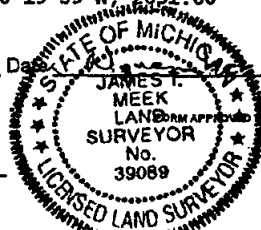

MICHIGAN BOARD OF LAND SURVEYORS, JAN 28, 19  
REVISED MAY 14, 19  
REVISED JAN, 19  
REVISED OCT., 19