LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970


For Corners In: Kalkaska (County)		Locate	ed in	Corner Code #	BK6 PG. 1023
Public Land Survey Property Controlling in Section	s	T 26N T	R R R	G6	PG. 1023
Miscellaneous Property in Section	\$ \$	T	RR		Register of Deeds Stamp & File Number
4. Lot No:	Recorded	d Plat:			A B C D E F G H I J K L M
5. Private Claims:	· · · · · · · · · · · · · · · · · · ·				2 6 5 4 3 2
I, Joshua R. Davidson, in a requirements of PA 74, Mic and 2 above were in conformation the current manual of surfinterior, Bureau of Land Ma corner points mentioned in of the Michigan Board of established, re-established, NOTE: Not more than 2 be recorded on this cere	chigan PA of rmance with vey instructi nagement of lines 3, 4 and Land Surv monumente 2 corners,	f 1970, the regulations ons of the r by a decre d 5 above veyors or bd, recovere	corner points read rules there and rules there united States ee of a Court of were in conform by a Decree conformation of the	nentioned in lines 1 efore as required in Department of the Law and/or that the nance with the rules of a Court of Law; oressed below:	3 4

A. Description of original monument and accessories and/or subsequent restoration:

G6 - 1/4 corner common to sections 15 & 16, T26N, R5W

- 1852 -GLO Resurvey Cannon Set quarter sect. post. 1) Maple 10" N23°E 26, 2) Maple 10" S30°W 19.
- 1913 Fargo Engineering Map #3515 No pipe set. No U.S. evidence.
- 1978 Consumer's Power Co. Survey drawing #S-F17406 D. Ankrom, PS #21265 Found 1¼" pipe with scribed post. 3) 12" Ash S45°W 13.35', 4) 6" Ash S60°E 15.37', 5) 8" Birch N55°E 7.61', 6) 14" Ash N30°E 9.92'.
- 1980 Certificate of Survey, L. 2, P. 601 N. Parker, PS #16939 No corner description 3) 12" Ash S45°W 13.35′, 4) 6" Ash S60°E 15.37′, 5) 8" Birch N55°E 7.61′, 6) 14" Ash N30°E 9.92′.
- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- <u>G6</u> Found 1" X 2.3' long pipe. Found witnesses #3, #4 & #6 in good condition. Found birch stump (#5) fitting position of pipe. No GLO evidence was found. Accepted found pipe as the **best available evidence of the position of the original corner** and replaced it with a 4" stamped DNR aluminum cap on 1" X 36" galvanized iron pipe.
- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- G6 Stamped 4" DNR aluminum cap on 1" X 36" galvanized iron pipe.

N30°E 10.09' to set nail & tag at found nail in W. side 18" R. Maple (#6) S60°E 15.41' to set nail & tag at found nail in SW. side 10" R. Maple (#4) S45°W 13.59' to set nail & tag at found nail in NW. side 17" R. Maple (#3) N54°W 42.84' to set nail & tag in NE. side 6" Oak Set blue post 1' North

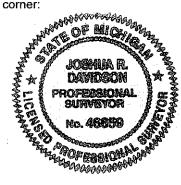

Signed by:

Surveyor's Michigan License No.:

46659

Date:

DEC. 16, 2014