

JAN 22 2001

Filed under Remonumentation Act 345 of 1990


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION



LIBER 1 PAGE 423

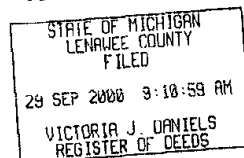

For corners in

Lenawee
(County)

Located In:

Corner Code #

1. Public Land Survey T 6-S R 3-E C 1
 T _____ R _____
 T _____ R _____
 T _____ R _____
2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
 Property in Sec S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard in a field survey on August 18, 2000,

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 John Mack Intersect N. bdy 8 chains W. of post. Set post at intersection cor. Sec.'s 5 & 6

B. Ash 14 S 49 E 4 Poplar 9 N 49 W 55

1855 Deed recorded in Liber 42, Page 51, described as N 1/2 of NW 1/4 Section 5, T6S R3E reserving a strip of land two rods wide across the west side

1960 Kenneth Suydam did survey and field notes show "NW corner Section 5" but doesn't show any witnesses or type of monumentation. It is shown west of a fence line to the south but no distance.

1966 Waller Frazier survey "Did not find NW corner Section 5. Assumed existing fence to be 2 rods East of Section line

1982 Kenneth Suydam Found rod 12" deep and raised with iron pipe

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

2000 I found iron pipe 1.67 N. of line between B-13 & C-13 T5S R3E and 616.97' west of C-13

August 18, 2000 Kevin Pickford set a 30" Harrison Monument stamped P.S. 13040 6" deep 616.97' West of C-13 T5S R3E on line to B-13 T5S R3E

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument 6" deep stamped P.S. 13040 and is accepted as the best available evidence of the position of the original corner.

dbl hd nail & re-mon tag in E.P. N 85° W 234.61

dbl hd nail & re-mon tag in E.P. N 60° E 52.72

Survey marker spike & re-mon tag in E.P. S 35° E 63.11

NE corner of brick house South 461.76

C-13 T5S R3E East 616.97

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 8, 2000Signed by Glenn E. Richard Date Sept. 25, 2000

Glenn E. Richard

Surveyor's Michigan License No. 13040

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1983

ADAPTED FOR WORD PROCESSING MARCH, 1993