

RECORDATION
JAN 2 2 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee
(County)


Located In:

Corner Code #



LIBER 1

PAGE 411

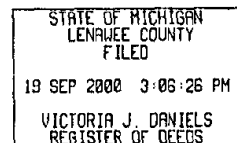

1. Public Land Survey T 6-S R 3-E E 11
T R
T R
T R
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec S T R

Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat
5. Private Claims

I, Glenn E. Richard in a field survey on August 8, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 John Mack D.S. Set 1/4 Sec. post W. Ash 10 S 1 1/2 W 13 W. Oak 6 N 7 E 18
Early 1900's John L. Richard's record "Found nothing. Took center of fence"
1929 Walter Frazier "Did not look for 1/4 post but used fence line South and point 8.35 ch north of S. fence of 16 acres" and notes call for g.p. (gas pipe)
1936 Part of Country Club Road was surveyed but unable to follow the notes.
1952 Kenneth Suydam did a survey and notes call for spike
1969 Kenneth Suydam found spike
1970 Werner Sommer found spike
1976 I found boat spike and replaced it with a 3/4" X 30" steel rod and recorded it in Liber 3, Page 428
1977? Arvin Butterfield P.S. 21561 found 3/4" steel rod and set 3/4" iron pipe in monument box after sewer construction using the same witnesses as shown on my recording in 1976 and recorded it in Liber 4, Page 18
1978? Werner Sommer set iron pipe from recorded witnesses. Set iron pipe south.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

May 17, 2000 I found 3/4" iron pipe in monument box and witnessed prior to road construction
August 8, 2000 Kevin Pickford P.S. 46682 found 3/4" X 23" iron pipe under new asphalt pavement. Checked the witnesses, replaced the iron pipe with 5/8" X 3' re-rod with re-mon capped P.S. 13040 and set monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County re-mon cap stamped P.S. 13040 in monument box and is accepted as the best available evidence of the position of the original corner.

1/2" X 24" re-rod capped GER 13040 North 38.59
1/2" X 24" re-rod capped GER 13040 South 36.25
Notch cut in RR spike in E.P. S 60° E 90.00
dbl hd nail & re-mon tag in SW face 24" Maple N 60° W 97.40
dbl hd nail & re-mon tag in NW face 24" Maple N 40° E 107.59
Fd. iron pipe South 32.99



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 22, 2000

Signed by Glenn E. Richard Date Sept. 15, 2000

Glenn E. Richard

Surveyor's Michigan License No. 13040