

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Lenawee
(County)


Located In:

Corner Code #



LIBER 2

PAGE 31

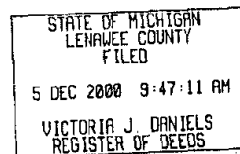

1. Public Land Survey

T-7-S R-5-E

L-1

T-6-S R-5-E

L-13

T- R-

T- R-

2. Property Controlling
in Section

S- T- R-

S- T- R-

3. Miscellaneous
Property in Sec

S- T- R-

S- T- R-

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Glenn E. Richard, in a field survey on November 15, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. This position not established by original government surveyors
1915 John L. Richard surveyed Bucholtz Hwy. He started at the center of Section 1 and ran north with a notation at this location "Found no corner" and shows deflection in road of 0° 24' left.
1974 Kenneth Suydam "Found iron, N 1/4 Cor. Sec. 1." (This is the same iron pipe that Werner Sommer found in 1973 and recorded it as L-13 T6S R5E)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Nov. 15, 2000 Found 3/4" iron pipe in pavement. Dug and found it was in the top of a 1" X 3' galv. pipe. Probed but didn't find anything else. Replaced it with 5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 and set monument box. The existing N. S. paved roadway is straight thru this location indicating possible single corner use when the road was re-built in 1915.

The peer group acknowledges the theoretical position of L-1 could be established at a different location but in as much as this corner was not established on the original GLO survey and has been used historically as a common corner the peer group approved this as a common corner with L-13 T6S R5E.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

5/8" X 3' re-rod with Lenawee County Re-mon cap stamped P.S. 13040 in monument box. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

Fd. dbl hd nail (added re-mon tag) in S. face E.P. N 50° W 39.35
Set dbl hd nail and re-mon tag in NW face of cable marker post N 50° E 29.74
Set dbl hd nail and re-mon tag in E. face of E.P. S 10° W 144.42
Cut "X" in face of chain link fence post S 40° W 54.06

K-13 T6S R5E West 2652.51
Fd. 5/8" rod @ M-13 T6S R5E East 2644.58



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Dec. 4, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040