

SURVEY &
DOCUMENTATION

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

JAN 22 2001

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in SECTION
Lenawee
(County)


Located In:

Corner Code #



LIBER 2

PAGE 12

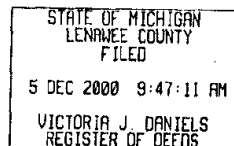

1. Public Land Survey T 7-S R 5-E L 10
T _____ R _____
T _____ R _____
T _____ R _____
2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
Property in Sec S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard, in a field survey on November 6, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management, or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

This position not established by original government surveyors
1883 James Blair set stake
1969 I set iron pipe at intersection of 1/4 lines
1984 George Warnke found 1/2" iron pipe. He notes stone 0.5 E and 0.2 S
1988 I found iron pipe
1996 Michael Bartolo found 3/8" iron pipe
1997 Steven Young found 1/2" iron pipe


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Nov. 6, 2000 Found 1/2" X 20" iron pipe 0.2 west of the NW corner of 10" (E&W) X 7" (N&S) X 2' deep granite stone with the top flush with the road surface. Also found another granite stone 2' deep at the west edge of the surface stone which I had to break off part of it to set the Harrison Monument at the location of the found iron pipe.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument stamped P.S. 13040. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner.

Capped iron rod (MJB 33970) East 33.00
Face of 3" steel post East 32.68
Fd. nail and aluminum disc in NW face of E.P. N 35° E 43.09
Fd. nail and aluminum disc in 18" stump S 85° W 52.73
S 1/4 corner Sec. 25 South 2648.81
N 1/4 corner Sec. 25 North 2632.35

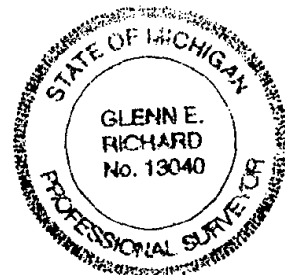

Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date November 28, 2000

Signed by Glenn E. Richard Date Nov. 30, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1975

REVISED JAN., 1993

ADAPTED FOR WORD PROCESSING MARCH, 1993