

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located In:

Corner Code #

**1. Public Land Survey**

T43N R 8W D5

T43N R 8W G5

T R

T R

**2. Property Controlling  
in Section**

S T R

S T R

**3. Miscellaneous  
Property in Sec.**

S T R

S T R

Register of Deeds Stamp & File Number

**4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_**

**5. Private Claims \_\_\_\_\_**

G5 Jul 07 1999

D5 Feb 15 1999

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(D5) Quarter corner common to Sections 8-17. Corner reestablished in 1968 by Billy D. Buckler, RLS, by single proportionate measurement. 1" pipe with 4" aluminum cap. 7" Balsam, S50E 34.1', 6" B.Spruce S82E 56.6'.

(G5) Corner common to Sections 9-10-15-16. Corner monumented in an erroneous position in 1968 and subsequently moved to the intended position (proportionate to corners north and south) in 1981 by Billy D. Buckler, RLS. 1" pipe with 4" aluminum cap. 8" Cedar S2 1/2E 64.8', 8" Cedar N4W 45.9'.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(D5) Recovered the 1968 monument in good condition and at record bearing and distance from the NBT 8. Spruce SE. The Balsam is dead and gone. Left the monument in place and marked 4 new, closer, witnesses. The corner lies on the east edge of an alder river bottom.  
(G5) Recovered the 1968 monument, a 1" pipe with 4" aluminum State of Michigan tablet, in good condition, and at record bearing and distance from the 1981 witnesses, both in good condition. Made new top blazes on the 1981 wits. and made two new accessories as described below.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(D5) Found 1" pipe with 4" alum. cap.

Blazed, scribed, and set measuring nails in the following:

4" W. Birch N42E 7.5' "1/4S NBT"

6" Spruce N80E 14.0' do

6" W. Birch S48E 23.4' do

5" W. Birch S30W 42.65' do

Placed a squared post adjacent.

Bearings are magnetic. Distances to nails with tags.

(G5) Found 1" pipe with 4" alum. cap.

Blazed, scribed, and set measuring nails in the following:

5" Balsam N87E 8.65' "S10 NBT"

5" Spruce S45W 19.1' "S16 NBT"


the 1981 wits:

12" Cedar S01E 64.65' "S15"

12" Cedar N02W 46.05' "S9"

Placed squared cedar post adjacent.

Bearings are magnetic. Distances to nail with tag.

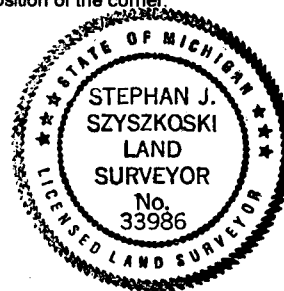

Signed by Stephan J. Szyszkoski

Date 8/29/00

Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division