For comers in

Mackinac	Located In:	Corner Code #
(County)		
1. Public Land Survey	T44H R 11 T44H R 11 T R	
2. Property Controlling In Section	S TR_ S TR_	
3. Miscellaneous Property in Sec.	S TR S TR	= ====


Register of Deeds Stamp & File Number

4. Lot No. Recorded Plat 5. Private Claims

Aug 19 1998

L Stephan J. Szyszkoski _, in a field survey on 19 do hereby state that under requirements of P.A. 74. Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

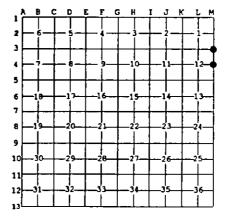

A. Description of original monument and accessories and/or subsequent restoration:

(M3) Corner common to Sections 1-12 T44N-R11N and Sections 6-7 T44N-R10N. Corner reestablished in 1969 by Billy D. Buckler, RLS: "This corner placed in center of M-S road and on an old tree line to east and west. Corner lies 18' north of an old fence line to west and in line with old fence to east. Corner monument 1 1/4" iron pipe, buried in N-S road. 18" Hard Maple (NST) M80M 41.9", 12" Hard Maple

(M4) Quarter corner common to Section 12 T44M-R11W and Section 7 T44M-R10W. Corner reestablished in 1969 by Billy D. Buckler, RLS: *This corner re-established midway bet. two Sec. Cors. and in approx. center of an old N-S road. Found no evidence of any corner here. Cor. lies 39.0' north of an old E-W railroad grade. Corner monument 1 1/4" x 30" iron pipe, buried in center of M-S road. B" Elm (1/45 M8T) \$83E 16.8', 12" Elm (1/45 M8T) \$52M 19.9'."

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(M3) Recovered the 1969 monument as described, in good condition, and at record bearing and distance from both 1969 witness trees. Measured 2624.33' Morth and 2633.66' South to adjacent quarter corners. Accepted the monument as a careful and faithful reestablishment of the position of the original corner. Left the monument in place and marked two new accessories as described below. Corner recovered and remitnessed by T.Stark and M.Feldpausch, Newberry District Office.

(M4) Recovered the 1969 monument, as described, in good condition, and at record bearing and distance from the stump remains of the 1969 witness trees. Meither have any visible markings. The monument was recovered 8.36' North of the record position: 2633.66' South and 2650.38' Morth of adjacent Section corners. This monument was used to control the subdivision of Section 12 by Billy D. Buckler, RLS, in 1980. I accept the monument as a careful and faithful reestablishment of the position of the original corner. Left the monument in place and marked four new accessories as described below. Corner recovered and rewitnessed by T.Stark and M.Feldpausch, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corn

Bearings are magnetic.

(M3) Found 1 1/4" iron pipe. Blazed, (M4) Found 1 1/4" iron pipe. Blazed, scribed, and set measuring nails in the scribed, and set measuring nails in the following: following: 26" Maple N79N 42.15' "S1" (1969 wit) 5" Haple M21W 23.9' "1/45 NBT" 16" Maple H42W 51.5' "S1" (1969 wit) 8" Elm S31N 25.3' "1/45 NBT" 14" Maple N62W 76.0' "SI NOT" 10" Elm 582W 19.0' "1/45 HBT" 12" Maple N23W 65.3' 5" Maple N45E 30.1" "1/45 HBT" "S1 N8T" Bearings are magnetic. Placed location tag on post N74W 13.4'.

AF MIE SZYSZKOSKI LAND SURVEYOR

For the Michigan Department of Natural Resources - Forest Management Division