

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Mackinac

(County)

Located in:

Corner Code #

1. Public Land Survey

T44N R 11W K2

T R

T R

T R

**2. Property Controlling
in Section**

S T R

S T R

**3. Miscellaneous
Property in Sec.**

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Oct 12 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(K2) Quarter corner common to Sections 1-2 T44N-R11W. Corner established in 1849 by William Ives: "South corrected [between Sections 1-2]...38.30 Set qr. section post. Beech 6 N35W 20, do 6 S22E 24...78.30 Section corner". Field notes from 1979 at the Michigan Dept. of Natural Resources Newberry District Office show that this corner was reestablished by single proportionate measurement to the original record in 1979 by Billy O. Buckler, RLS. The reestablished position was used to control the subdivision of Section 1 at that time, but the corner position of K2 was not monumented. Buckler measured 5137.0' (77.833 ch.) between K3 and K1.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


(K2) Original post and accessories were not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner by single proportionate measurement to the original record: on a line of mean true bearing between K3 39.7413 ch. south and K1 38.0521 ch. north. I observed the mean true bearing of the line to be N 00 deg. 07' 54"W. At the position for the corner, I placed a 1" ID iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark and M.Feldpausch, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(K2) Set 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:

10" Cherry S07E 16.3' 1/4S NBT"
24" Beech S20E 28.9' 1/4S NBT"
16" Beech S34W 15.55' 1/4S NBT"
10" Beech N71E 25.55' 1/4S NBT"

Placed a squared cedar post adjacent.
Bearings are magnetic.

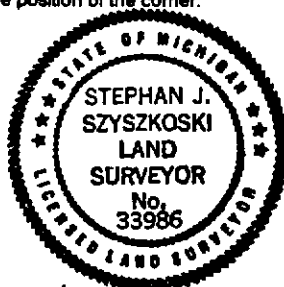

Signed by

Stephan J. Szyszkoski

Date

11/18/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division