

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF—:	LOCATED IN—:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. <u>23</u> N. R. <u>13</u> W.		B-5; C-4; C-5
2. PROPERTY CONTROLLING IN SECTION <u>6</u> T. <u>23</u> N. R. <u>13</u> W.		Code 15
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. S. R. _____ E. W.		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970 the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram—over) were, in a field survey on 1-9 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence, etc.

C-5 Accepted existing old corner fence post (fn. N-S-W) as proper corner. Fits 1/4 corner and Sec. corner to North.

Code 15 Established corner per standard B.L.M. instructions.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

B-5 Recovered J.H. Millard corner of record, Old Cedar fence post, wire E & SW and Millard wit., Cedar stump 12", S24E, 16 L. Millard found stake with marked B.Ash wit. correct in Jan. 1900 (See Co.Sur.Book, pg 6 & 7 at Reg. of Deeds). This corner looks wild but was recovered and used by Millard to split up Sec.7. U.S. survey in this area is very shaky and I believe Millard actually had the Govs. corner.

C-4 Recovered iron & stones in ctr. of N-S B.top rd from J.H. Millard Wit 1900. See Co. survey records at Reg. of Deeds.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-5	C-4	Code 15
Set DNR mon & Cedar Gd. post by corner fn.post	Fd. 3/4" Iron & stones Raised with 1"x12" rd iron	Set 1"x36" pipe & Ced. post w/loc tag
6" Maple N87E 39.6'	18" B. Cherry N72E 8215'	5" Oak S27W 50.5'
8" Maple N83W 35.0'	17" Oak S65E 97.33'	12" Maple S71W 60.5'
6" Maple S66W 31.1'	Fn.cor Fn N-S-W Due W 28'	13" Maple N28W 26.5'

B-5	C-4
Set DNR mon & Cedar Gd. post by Millard corner	Set Cad post w/loc tag
14" Hemlock S77W 7.3'	Due E 33'
14" Hemlock N15E 4.8'	

SIGNED BY 8" Cedar S85E 30.9'

Carl F. Roser DATE 6-15-73


SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ CHIEF OF SURVEY PARTY

DATE _____

APPROVED AND SIGNED BY _____ MICHIGAN REGISTERED LAND SURVEYOR

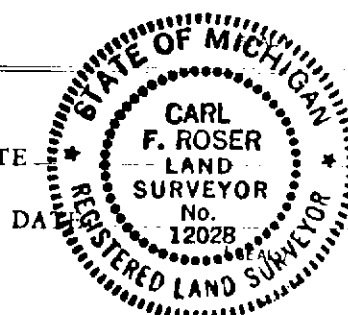

SURVEYOR'S MICHIGAN REGISTRATION NO. _____