SURVEY &

, Recorded Plat


For corners in

Private Claims

REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE APR 1 1 1995 Filing Requirement of Act 74, Mich. P.A. 1970 MENOMINEE COMMISSIGNED In: Corner Code ## 32NR . MC J/K-9 <u> 27</u>W **Public Land Survey** R R **Property Controlling** in Section Register of Deeds Stamp & File Number Miscellaneous Property in Sec.

Dec. 05 94 William Lenca in a field survey on do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as

expressed below: NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

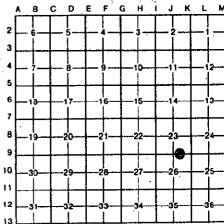

WILLIAM LENCA RVEYOR

- A. Description of original monument and accessories and/or subsequent restoration:
 - Original Survey by James H. Mullett B.T.'s Maple, 8", S53°W, 123 lks; Aspen, 9", N44°W, 210 lks. All original evidence for this corner has been destroyed by shore line erosion.
 - Plat of Survey by Robert Olsen, surveyor, shows this corner as being a 12" dia. cedar post 509' East of the Quarter Corner 1958: between Sections 23 & 26. This corner has been destroyed by shore line erosion.
 - Plat of Survey by William Lenca, RLS No. 26461, shows a 5/8" x 24" Iron rod/Ident. cap set 402.26 feet East of the 1/4 1990: Corner between Sections 23 & 26, and on an extension of the line between said 1/4 corner and the Section Corner 1/2 mile West.
- Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found the 5/8" x 24" iron rod at the edge of the shore of Green Bay, and just inside the tree line as indicated in our 1990 Plat of Survey. The distance from this location West to the 1/4 Corner between Sections 23 & 26 is 402.26 feet compared to the GLO distance of 468.6 feet. The lot lines to the South, established in Olsen's 1958 Plat of Survey, run parallel with the line established between this corner and the 1/4 corner between Sections 23 & 26. We accepted the position of the 5/8" x 24 " Iron rod as the best available evidence of the position of the original Section Line, and as a reference to the Meander Corner. OF MICHIZ

LERED LAND Description of monument for corner and accessories established to perpetuate locating the position of the corner

Set 2-1/2" dia. Alum. pipe/3-1/4" dia. Alum. Cap stamped for corner location in place of existing 5/8" x 24" iron rod:

5" dia. White Ash	S27°E	32.26 feet	Scr. NBT
18" dia. Oak	S40°W	57.65 feet	
5/8" x 24" Iron Rod/2" Alum. cap marked WITNESS MARKE	R SOOOE	5.22 feet	@ Survey Sign
18" dia. White Pine	S67°W	7.41 feet	
Survey Sign Post	S00°E	5.6 feet	
But vey bight tost			

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William France	Date	Dec. 15, 1994
Signed by William Sinha	Date	
Surveyor's Michigan License No. 26461	FORM AP	PROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 19 REVISED MAY 14, 19
		REVISED JAN., 19