## SURVEY & REMONUMENTATION

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

MAR 02 2001

SECTION

**Ontonagon County** Located in: Corner Code # 1. Public Land Survey T51N R38W T R T R T R 2. Property Controlling T R in Section S T R Miscellaneous S T R Property in Sec. S

UDITH D. ROEHM 1P Ontonagon County Page 1 of 1 LC 5/362 JEM Date 01/03/2001 14:36:34 RECORDING FEE: 9.00

1

4. Lot No.


For corners in

. Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on November 30, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

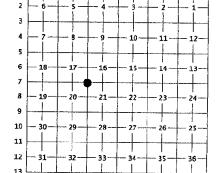

Register of Deeds Stamp & File Number

G

A. Description of original monument and accessories and/or subsequent restoration:

(E-7) Corner Common to Sections 16,17,20 & 21, T51N, R38W

1846- H. and S.W. Higgins set a post.

10" Sugar N 35°E 15 links 12" B. Ash S 60°W 20 links

I found no record of subsequent restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. At the corner position there is now a North-South Barbwire fence constructed over 30 years ago along the long accepted Section line. The Section line was buildozed to put in the fence and in so doing destroyed any remaining evidence of it. I created a position for the section corner using the proportionate position for the latitude. (Between ¼ Corner ½ mile south and Section Corner one mile North. Section Corner is a 5/8" iron pin at fence corner with old location poster facing it.) For the departure of the Section corner I held the North-South Fenceline. I believe this postion to be the best representation of the postion of the original section corner.

Research on file with County Remonumentation Representative.

C. Description of monument for comer and accessories established to perpetuate locating the position of the comer:

Corner is a 2 1/2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R38W; S.16, S.17, S.20, S.21; 2000; P.S. 37273. Ties:

2612.38'

4" Poplar 9.70 S 02°E 3° Poplar S 70°W 42.69 4" Poplar N 65°W 22.15 Steel Sign Rail 0.70' (to face) North NW Cor. Sec. 16 N 00°10'47"W 5223.68 N 1/4 Cor. Sec. 20 N 87°56'39"W 2761.61 N 1/4 Cor. Sec. 21 S 88°01'01"E 2615.51

DOMITROVICH SURVEYOR LAND COURTY LL FACE

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted. Bearings shown between corners are on assumed basis, for reference only.

S 01°08'10"W

Staned by

Surveyor's Michigan License No. 37273

W 1/4 Cor. Sec. 21

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983 REVISED JOLT., 1995

12-19-00

IOSEPH