9,00

JUDITH D. ROEHM

RECORDING FEE:

LAND CORNER RECORDATION CERTIFICATE Ontonason County Filing Requirement of Act 74, Mich. P. A 3 3 70 of 1 Vate 06/12/2000

LC 5/285 Time 16:29:55

For corners in

Ontonagon County 1. Public Land Survey

2. Property Controlling

Property in Sec.

Located in:

Corner Code #

1-6

**T52N R39W** R T T R R T Т R S R T S S

**SURVEY &** REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

Lot No.

s , Recorded Plat


5. Private Claims

in Section

Miscellaneous

1, Joseph C. Domitrovich, in a field survey on April 11, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above requirements of P.A. 74. Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

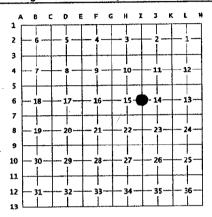

A. Description of original monument and accessories and/or subsequent restoration:

(1-6) 1/4 Corner Common to, Sections 14 & 15, T52N, R39W.

1845 - William A. Burt set a B. Ash Post with ties:

12" Cedar

S 26°E

23 links

16" Cedar

N 11°W

10 links

1953 - Ned Hawley, Timber cruiser, set 1" x 6' red pipe with part of union on top at the correct bearing and distance from the original 16" cedar B. T. (As noted in his personal copy of the original notes.)

1988 - Robert Mick, P.S. 16936, on survey dated 1988, shows this corner as being S 00°29'04"E, 2609.63' from NE Corner of Section 15 but does not indicate what corner is.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I recovered the pipe as called for by Ned Hawley and the 16" cedar B.T. Numerous old blazes face the pipe. The Cedar is now a 16" windfall, decayed but axe marks from the original blaze are still visible. Distance to NE Comer of Section 15 works fairly well with Mick's distance. I accepted the iron pipe as the ¼ corner.

Research on file with County Remonumentation Representative.

PEER GROUP APPRO COLUMN -24-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1 1/2" iron pipe with a 3/2" x 96" aluminum rod driven inside of it and a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W; 1/4, S. 14, S. 15; 2000; P.S. 37273. Ties:

> N 06°E 13.10' (Existing) 7" Cedar S 15°E 12.12' (New) 5" Cedar 14.90' (Existing) 8" Cedar S 62°W (Existing) 8.42' 7" Cedar N 73°W (To Face) N 10°W 0.62' Sign Rail NE Cor. Sec. 15 N 00°24'42"E 2610.50 S 00°29'07"E 2663.85 SE Cor. Sec. 15

DE BICHIE IOSEPH DOMITROVICH LAND SURVEYOR FOLAHD

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.