1F

Ontonason County

LAND CORNER RECORDATION CERTIFICATE 1
Filing Requirement of Act 74, Mich. P. 41 920 06/12/2000

LC 5/294

RECORDING FEE:

Time 16:36:37 9.00

For corners in

Ontonagon County Located in: Corner Code # 1. Public Land Survey T52N R39W M - 10 T52N R38W A - 10 R T R R 2. Property Controlling T in Section S T R Miscellaneous S T R Property in Sec. S

SURVEY & REMONUMENTATION

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on May 15, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

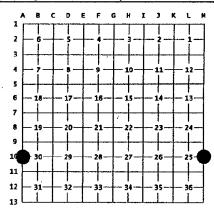

A. Description of original monument and accessories and/or subsequent restoration:

(A - 10/M - 10) 1/4 Corner Common to Section 25, T52N, R39W and Section 30, T52N, R38W.

1845 - William A. Burt Set a Fir post at the corner with ties:

20" Cedar

N 35°E

2 links

16" Hemlock

N 23°W

16 links

1935 – Ned and John Hawley, Timber cruisers, noted in their copy of the original notes that the original Hemlock was green and standing and that they replaced the fir post with a Hemlock stake.

B. Description of comer evidence found and/or method applied in restoring or reestablishing comer:

I found an intersection of old fences East and South which works well with remains of original Hemlock Bearing Tree to the Northwest, now a 28"+ rotten stump. I found no remains of the 20" cedar. This position works well with section corners to the North and South. I accepted this position as the ½ corner and placed a County Monument at it.

Research on file with County Remonumentation Representative.

Sal W leplekang 5-24-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner;

Corner is a 2 ½" x 30" Aluminum pipe with a 3" diameter Aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W, R38W; ½; S. 25, S. 30; 2000; P.S. 37273. Ties:

6" Cedar	N 30°E	14.87'
Metal Fence Post	East	0.95'
6" Hemlock	S 33°W	9.33'
Metal Sign Rail	West	0.85'
5" Cedar	N 50°W	15.17'
8" Hard Maple	N 02°W	9 04'

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

JOSEPH
DOMITROVICH
LAND
SURVEYOR
No.
37275

Date 5/24/00

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1893 REVISED OCT., 1998