RECORDING FEE:

LAND CORNER RECORDATION CERTIFICATE Untonasion County

Filing Requirement of Act 74, Mich. P.A: 1970 of 1 Ontonagon County Remonumentation Comerce. Date 05/26/98 Time 10:44

Corner Code #

5/ 61

For corners in

Ontonagon County Located in: 1. Public Land Survey **T47N R40W** T R Т R T R 2. Property Controlling T R in Section S T R Miscellaneous S T Property in Sec. S

Register of Deeds Stamp & File Number

4 I of No.


, Recorded Plat

5. Private Claims

SECTION

I, Joseph C. Domitrovich, in a field survey on January 5, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

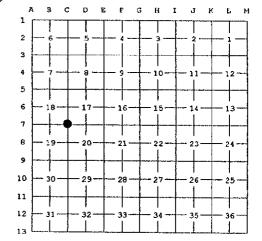

A. Description of original monument and accessories and/or subsequent restoration:

Corner of Sections 17,18,19 and 20, T47N, R40W

1851 Wells Burt set post:

14* Cedar

N55°W 12 links

24" White Pine

S23°W 14 links

1972 Donald Lappala P.S. 12585, for U.S. Forest Service, recovered the fallen 14" Cedar Bearing Tree and remains of the stump of the White Pine Bearing Tree. He reset a 2" x 5" galvanized iron pipe with a 3" diameter brass cap at the corner using the recovered Bearing Trees and established 4 new witnesses: 62.2

a. 20" White Pine

West

N12°E 39.0'

c. 18" Spruce

b. 17" White Pine

\$35°W

d. Steel Sign Post

N53°w

B. Description of comer evidence found and/or method applied in restoring or reestablishing corner:

13.6

2.9

I recovered the Forest Service Monument set by Lappala. It had been pushed down flush with the ground by a Skidder. I also recovered the three Bearing trees and the bent base of the steel sign post. Distances from the Bearing Trees to the recovered monument checked well. I accepted the monument as found. I added nails to the sides of the existing bearing trees and accepted them. I found no remains of the original Bearing trees noted by Lappala.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a recovered 2" diameter galvanized pipe with a 3" diameter stamped brass cap. Witnesses:

a. 24" White Pine

West

62.20'

(Existing)

b. 17" White Pine c. 20" Spruce

N15°E \$35°W 39.00 13.57

(Existing) (Existing)

13" Ѕргисе Steel Sign Post

N52°W East

52.04 (New) 0.90' (New)

JOSEPH DOMITROVICH AND VEYOR

of Bienie

NOTE: Bearings are magnetic. Distances are to a nail in side of the witness object unless noted.

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975

REVISED JAN., 1983

LCRC T47N R40W C-7.doc