LAND CORNER RECORDATION CERTIFICATE Unterseen County

96 Filing Requirement of Act 74, Mich. P.Ā31970 of 1 LC 5/ 96
Ontonagon County Remonumentation Content Date 06/25/98 Time 12:11 9.70

For comers in

Located in: Corner Code # **Ontonagon County** T52N R39W 1. Public Land Survey 1-4/5 T R R T T R 2. Property Controlling S in Section S T R 3. Miscellaneous 3 τ R S Property in Sec.

RECORDING FEE:


4. Lot No.

, Recorded Plat

5. Private Claims

I, Joseph C. Domitrovich, in a field survey on June 8, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decrae of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

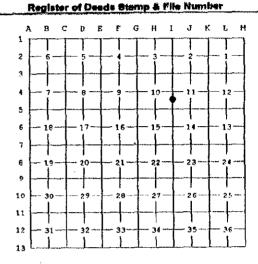

A. Description of original monument and accessories and/or subsequent restoration: (1-4/5) Meander Corner Common to Sections 10 & 11, T52N, R39W

1845 - William A. Burt set Meander Post

16.50 chains (1089.0') North of the Section Corner.

22" Hemlock

S 17º E

37 links

1978 - Robert Mick, P.S. 16936, in a survey recorded in Liber 1, Page 40 of Surveys, in Ontonagon County Register of Deeds Office, shows a bent iron pipe on West line of Section 11 that is N 00° 39' 18" E 960.54 feet from the Southwest Corner of Section 11.

B. Description of comer evidence found and/or method applied in restoring or reestablishing comer:

The original corner and accessories have been destroyed by shoreline erosion. I was also unable to recover the pipe called for in the Mick survey. I calculated a position for this corner from other corners recovered in Mick's recorded survey. The Section line defined by this position works well with dimensions called for in numerous deeds in Section 11. Laccepted this position as a Witness Corner to the Meander Corner and monumented it as such. The Meander Corner position now falls in Lake Superior.

Research on file with County Remonumentation Representative.

doplekanp 11-98 COUNTY

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner:

Corner is a 3/1 x 7' aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; S. 10, S. 11; W.C.M.C.; T.52N, R.39W; 1998; P.S. 37273. It is also stamped to indicate that the Meander Corner is N 00° 51' E 128.56'. The corner falls 85 feet South of edge of the water. 01 HIEN,

Witnesses:			
11" Soft Maple	N 30° E	7.90'	(existing blaze)
6" Soft Maple	N 67° E	34.28'	
5" White Pine	S 55° E	13.42"	
12" White Birch	S 22° W	11,13'	(grown over blaze
10" dead White Birch	S 47° W	18.27'	(existing blaze)
Steel Sign Post	North	0.52'	(to face)
SW Cor. Section 11	S 00° 50′ 57″ W	960.44'	

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object to

6-17-98 Date

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975 REVISED JAN., 1903 REVISED OCT., 1895

JOSEPH DOMITROVICH