

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Schoolcraft (County)	Located In:	Corner Code #
1. Public Land Survey	T 43N R 16W	H11
	T 43N R 16W	I10
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

4. Lot No. _____, Recorded Plat _____
5. Private Claims

I10 Dec 19 2005
H11 Dec 07 2005

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


(H11) Quarter corner common to Sections 27 and 34. 1850 - Established by A.Merryweather, Deputy Surveyor: Set post midway and on the line between Section corners 40.00 chains east and west. Bearing trees: Cedar 8 S45W 5 links, Cedar 7 N53E 11 links.
(I10) Quarter corner common to Sections 26 and 27. 1964 - Rewitnessed by A.O.Enger RLS: "Corner located and pipe set by Carl Christensen and Carl Makel from one original bearing tree stump". Mr. Enger described the Christensen monument as a 2" ID iron pipe with 2 1/2" brass cap stamped "27-1/4-26, c.c". Mr. Enger's NBTs: Cedar 5 S79W 18.5 links, Cedar 7 S18E 35.5 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H11) The original post and accessories were not recovered. Reestablished the corner midway and on the Section line between Section corners I11 and G11 2645.18' east and west.
(I10) Recovered the Christensen monument disturbed by a fallen cedar. Reset the monument in the 1964 position in accord with the 1964 NBTs and the original Cedar 8T stump N65E 21 links distant.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H11) Set 1"IDx36" I.pipe with 4" alum. MDNR cap. Set measuring nails in:	(I10) Reset record 2"ID iron pipe with 2.5" brass cap. Set measuring nails in:
8" Cedar N30E 9.75' mrkd "1/4S NBT"	11" Cedar S17E 23.5' mrkd "1/4S" *
8" Cedar N43W 14.65' do	8" Cedar S80W 12.35' do *
9" Cedar S71W 9.8' do	10" Cedar N83W 37.75' mrkd "1/4S NBT"
7" Cedar S06E 12.3' do	10" W.Birch N85E 28.65' do
Bearings are magnetic. Distances are to nail with tag.	Bearings are magnetic. Distances are to nail with tag. * denotes 1964 NBT.

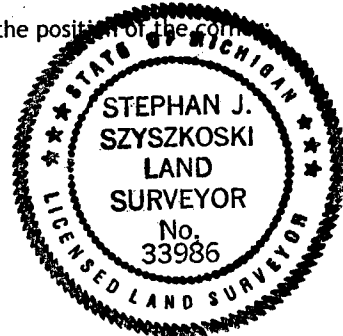

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 12/6/06

For the Michigan Department of Natural Resources, Office of Land and Facilities