

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Schoolcraft  
(County)

Located In:

Corner Code #

1. Public Land Survey

T43N R 16W

M3

T R

T R

S T R

2. Property Controlling  
in Section

S T R

S T R

3. Miscellaneous

S T R

Property in Sec.

S T R

4. Lot No. , Recorded Plat

5. Private Claims

I, Stephan J. Szyszkoski, in a field survey on Oct. 24, 2007 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


(M3) Corner common to Sections 1-12 T43N-R16W and Sections 6-7 T43N-R15W. 1841 - Established by Wm.A.Burt, Deputy Surveyor: Set post corner of Sections 1&12. W.Birch 5 S61E 35 links, W.Pine 6 N43W 32 links. 1850 - Additional BTs by A.Merryweather, Deputy Surveyor, made during subdivision of T43N-R15W: Birch 6 S50E 4 links, W.Pine 6 N50E 8 links. 1969 - Corner reestablished by F.J.Bray RLS by single proportionate measurement to the original record between Township corner 1 mile north and Section corner two miles south. Set 1" iron pipe with 4" aluminum cap. new BTs: 11" R.Pine N35E 25 links, 11" R.Pine S43E 39 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(M3) Found the 1969 monument in good condition and at record bearing and distance from the remaining 1969 NBT R.Pine SE, now 17" diameter in good condition with overgrown blazes. the R.Pine NBT NE was not recovered. Verified the position of the monument with respect to the reestablished township corner of record 5481.59' north and the reestablished section corner 5281.74' south and found it in accord with the record. Accepted the monument as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(M3) Found 1"ID I.pipe with 4" alum. State of Michigan cap. Set measuring nail with MDNR tag in the side of:  
17" R.Pine S39E 26.29' mrkd "S7" (this is 1969 NBT)  
12" R.Pine S45W 2.62' mrkd "S12 NBT"  
15" R.Pine N60W 20.68' "S1 NBT"  
16" R.Pine N50E 25.21' "S6 NBT"  
Set carsonite post 1.0' north.  
Bearings are magnetic.

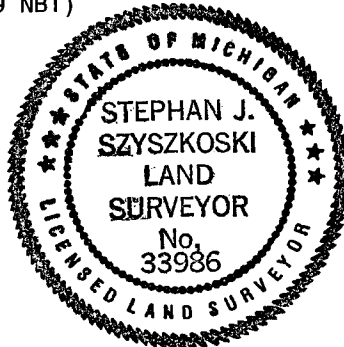

Signed by Stephan J. Szyszkoski Date 11/1/07

Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources, Office of Land and Facilities

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS

