## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Schoolcraft	Located in:	Corner Code #
(County)		
1. Public Land Survey	T <u>46#</u> R_ TR_ TR	15N <u>E6</u>
Property Controlling     In Section     Miscellaneous     Property in Sec.	TR S_17 T_46N R S TR S TR S TR	15M 16


Register of Deeds Stamp & File Number

<ol><li>Lot No, Recorded Plat_</li></ol>		_	
5. Private Claims			
	E6	Apr 20 1998	

L Stephan J. Szyszkoski in a field survey on 10 do hereby state that under requirements of P.A. 74, Michigen P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current menual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

Apr 23 1998

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

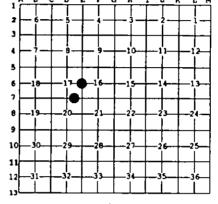

A. Description of original monument and accessories and/or subsequent restoration:
(E6) Quarter corner common to Sections 16-17. Corner reestablished by Single proportionate measurement in 1960 by Billy D. Buckler, RLS. Description of corner monument: 1° pipe with 4° brass cap. Witnesses to corner 12° forked maple S66W 65 links, 8° maple S07E 14

(16-Sec. 17) East 1/16 corner between Sections 17-20. Corner not established in the original survey. Found no subsequent record.

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

(£6) Recovered the 1960 monument as described, a 1" I.O. iron pipe capped with a 4" dia. brass MI Dept. of Conservation tablet, in good condition and at record bearing and distance from the 1960 witnesses, both recovered in good condition. Left the monument in place and marked two new accessories as described below. Corner recovered and remitnessed by T.Stark and M.Feldpausch, Mawberry District Ofice. From the corner, an E-W road bears south, approx. 30 ft.

(16-Sec. 17) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1327.95' Mest and Section corner 1327.95' East. At the position for the corner, I placed a 1'IDx36' iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark and M.Feldpausch, Newberry District Office.

C. Description of monument for corner and a (E6) found 1° pipe with 4° brass cap.	ccessories established to perpetuate locating the po (16) Set 1 pipe with 4 MMR cap.	ceition of the committee
Blazed, scribed, and set measuring nails	Blazed, scribed, and set measuring mails	The state of the s
in the following:	in the following:	STERLIAN
24" Forked Maple \$71H 42.9' 1960 wit.	6" Hemlock N74E 9.8' "E1/16 BT"	STEPHAN J.
18" Maple S06E 9.0' 1960 wit.	5" W. Birch \$34W 6.B' "E1/16 BT"	* SZYSZKOSKI
14" Maple S19W 22.2' "1/4S MBT"	5" W. Birch NS7W 9.55' "E1/16 BT"	LAND *
14" Hemlock S35N 45.25" "1/45 HBT"	4" N. Birch NI3W 12.5' "E1/16 BT"	SURVEYOR
Placed a 3" squared and scribed post	Placed a 4" squared and scribed post	33986
adjacent. Bearings are magnetic.	adjacent. Bearings are magnetic.	The state of the s
	•	721 VARU -

For the Michigan Department of Natural Resources - Forest Management Division