

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich, P.A. 1970

SURVEY &  
REMONUMENTATION

NOV 02 1999

For corner in

Washtenaw  
(County)

Located in:

Corner Code #

SECTION

1. Public Land Survey

T 1S R 3E


K-5

2. Property Controlling  
in Section

S T R

3. Miscellaneous  
Property in Sec

S T R

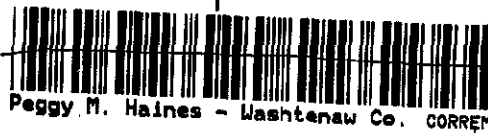

5017320  
Page: 1 of 2  
02/25/1999 02:59P  
L-2 P-204

Peggy M. Haines - Washtenaw Co. CORRECTION

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Charles C. Wilson, in a field survey on June, 19 98,  
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points  
mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as  
required in the current manual of survey instruction of the United States Department of the  
Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner  
points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan  
Board of Land Surveyors or by a Decree of a Court of Law; established, re-established,  
monumented, re-monumented, recovered, found as expressed below.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded  
on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

United States Government Survey, 1815 Instructions, Surveyed 1825  
Bearing Trees A) B. Oak 12" N42deg.W 7.26  
B) W. Oak 14" S81deg.E 4.29

Continued on Back

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1-1/2" Iron Pipe 6" below ground surface. No evidence of stones or bricks. Raised 1-1/2" Iron Pipe  
to 4" above ground surface. Set Remonumentation Cap Stamped #13604 on top.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

1-1/2" Iron Pipe with Remonumentation Cap Stamped #13604 (4" above ground surface)  
1) 32" Oak S87deg.W 90.30 (Nail & RT S/S)  
4) 14" Cherry S40deg.E 22.76 (Nail & RT NE/S)  
5) 6" Cedar S45deg.E 36.43 (Nail & RT NE/S)  
6) 10" Cedar N10deg.W 47.35 (Nail & RT E/S)  
7) Twin 4"-6" Cedar N49deg.E 49.52 (Nail & RT NW/S)  
8) 16" Oak N78deg.W 32.25 (Nail & RT SW/S)

I feel that this point should be accepted as a careful and faithful perpetuation of the position of the original corner.  
This corner was ratified by the Peer Committee on August 10, 1998



Signed by Charles C. Wilson  
Surveyors Michigan's License No. 13604

Date August 10, 1998

APPROVED

DATE 8-10-98  
CO. REP. K

COPY

NOV 02 1999

## SECTION

K-5

## Paragraph A continued:

Washtenaw County Road Commission  
 W.J. Armstrong, PLS#2444, June 1938  
 WCRC Book 134, Pages 70 & 71  
 WCRC Grid Book



- COPY -

Found remains of Tap Root of B) and Mould remains of Roots of A). Also found Large End Post. Set 1-1/2" x 40"  
 Iron Pipe, Stones & Bricks at intersection of remains of accessories A) & B)  
 Point falls at West side of Large End Post.

- 1) W. Oak 16" S87deg.W 90.0      2) W. Oak S87-1/2deg.W 137.5      3) W. Oak 16" S87-1/2deg.W 145.6

Patrick L. Benton, PLS#19826, February 1975

## Survey Drawing

- 1) 32" Oak S85deg.W 90.00 (Nail S/S)      4) 10" Cherry S55deg.E 22.85 (Nail E/S)      5) 5" Cedar S45deg.E 36.50 to center

Charles C. Wilson, PLS#13604, January 1976

Land Corner Recordation Certificate, Liber 4, Page 73, Found 1-1/2" Iron Pipe

- 1) 30" W. Oak S87deg.W 90.0      2) Stump S87-1/2deg.W 137.5      5) 5" Cedar S45deg.E 36.5  
 6) 2" Cedar N10deg.W 47.8      7) 2" Cedar N45deg.E 49.5

C. Wilson & Associates, Inc., Charles C. Wilson, PLS #13604, 1977

Survey Drawing, Found 1-1/2" Iron Pipe

- 1) 30" W. Oak S87deg.W 90.0      2) Stump S87-1/2deg.W 137.5      5) 5" Cedar S45deg.E 36.5  
 6) 2" Cedar N10deg.W 47.8      7) 2" Cedar N45deg.E 49.5

C. Wilson & Associates, Inc., Charles C. Wilson, PLS #13604, September 1978

Survey Drawing, Found 1-1/2" Iron Pipe

Washtenaw Engineering. Co., Inc., Norman N. Fahrner, PLS #17620, June 1979

Survey Drawing, found 1-1/2" Iron Pipe

- 1) 30" W. Oak S87deg.W 90.0      2) Stump S87-1/2deg.W 137.5      5) 5" Cedar S45deg.E 36.5  
 6) 2" Cedar N10deg.W 47.8      7) 2" Cedar N45deg.E 49.5

Donald L. Bissell, PLS#18655, October 1987

Land Corner Recordation Certificate, Liber 7, Page 142, Found 1-1/2" Iron Pipe

- 4) 6" B. Cherry S40deg.E 22.82      6) 5" R. Cedar N09deg.W 47.43      7) 3" Twin Cedar N39deg.E 49.56  
 8) 9" Oak N78deg.W 32.30

