SHUNCLE MONUMENTATION Received to

JAN 182001

SECTION

as expressed below:

LAND CORNER RECORDATION CERTIFICATE

Approved by Alger County
Land Survey Hemonumentation
Peer Group Under Act 345 of
P.A. of 1990 On 12-13 19 2000

P.A. of 1990 On 12-13 13 2000	
Merall cexular	

Of Comers in	Filing Requi	rement of Act 74, Mich. P.
Alger	Located in:	Corner Code #
(County)		
Public Land Survey	48N 15W	A01

Chairman 05-204

FILED TIME 8:50 Am.

DEC 20 2000


DONALD W. KINNUNEN REGISTER OF DEEDS ALGER COUNTY, MI

Register of Deeds Stamp & File Number

T 49N R 15W T 48N R16W MO1 T 49N R16W M13 2. Property Controlling s _ _T ____ R ____ S ___ T ___ R ___ in Section ___T ____ R ____ __T ___ R ____ 3. Miscellaneous Property in Section ____, Recorded Plat 4. Lot No. 5. Private Claims

Robert L. Jamros May 12 , in a field survey on do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

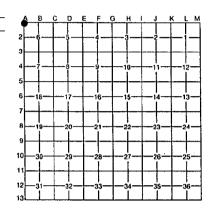

A. Description of original monument and accessories and/or subsequent restoration:

A01: PLS John Burt, DS, 1841. Set post corner of Township 48 and 49 North between Ranges 15 and 16 West. Y. Pine 14", N.26°E., 67 links. Spruce 9", S.27°W., 14 links. ***** C.C.I. Co. Ray J. Brotherton, RLS, 1948. Set iron and 4" post from Government BT, a Y. Pine stump, N.26°E., 67 links, notch plain. W. Pine 6", S.48°E., 62.5 links. W. Pine 10", N.56°W., 97.5 links. Unrecorded.**** Michigan Department of Conservation, Forestry Division. Billy D. Buckler, RLS, 1960. Set 1" iron pipe with 4" brass cap at corner position of a broken spring leaf iron. Found Y. Pine stump bearing Northeast from corner position, notch and part of bottom blaze plain. W. Pine 10", (S6 NBT) S.43°E., 63 links. R. Pine 14" (S36 NBT) N.08°E., 126 links. Liber 2, Page 159, Alger County corner records. ***** No other subsequent restoration of record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A01: Found 1" iron pipe with 4" brass cap and NBT's of the 1960 report in good condition. Found broken spring leaf iron at base of above monument, NBT's of 1948 report are lost. Corner monument position as found is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Existing 1" iron pipe with 4" brass cap as found. Renewed existing NET's with BT signs and paint. Established additional reference trees with BT signs, blazed, scribed and painted. Set PK nails for measure with aluminum I.D. washers in the following: Ex. NBT, R. Pine 26", N.01°W., 83.63 feet (blaze scars); Ex. NBT, W. Pine 28", S.43°E., 41.76 feet (blaze scars); R. Pine 8", S.54°W., 33.64 feet (S1 BT); R. Pine 14", N.58°W., 30.0 feet (S36 BT). Survey marker sign on 6 foot steel post, S.34°W., 1.0 feet. All bearings are magnetic.

Signed by_ 25849 Surveyor's Michigan License No.

____ Date <u>_ *D* ఆ డ</u>

ROBERT L. SCRMAL ROFESSIONAL SURVEYOR No.

PROFESSION FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN., 1983

REVISED OCT., 1995