
## LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:		Located in		Corner Code #
(County)				
1. Public Land Survey		T 30N	R 6W	E4
Property Controlling in Section	s	T	R	
Miscellaneous     Property in Section	s	Т	R	· · · · · · · · · · · · · · · · · · ·
	S	Τ	R	
	s	Т		
4. Lot No:	Recorded Plat:			
5. Private Claims:				
I Corl T Vijekile in a field every on but C 2040 de beach, etch that and				

Register of Deeds Stamp & File Number

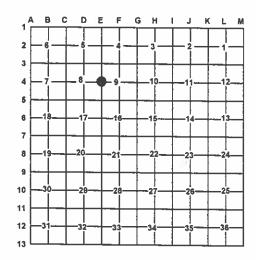

I, <u>Carl T. Kiiskila</u>, in a field survey on <u>July</u>, 6 2010 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E4 - 1/4 Corner common to sections 8 & 9, T30N,R06W

1976 – L.C.R.C. (from DNRE Land Corner File) – Carl F. Roser, P.S.#12028 – Found and accepted 1 ½ " pipe. Set DNR cap on 1" pipe inside same. 1 ½ " pipe was recovered by department in 1961. RLS Bob Findorff also used this corner in 1967.

20" Maple S61°E 60.5'; 9" Maple N65°E 60.2'; 8"B. Cherry N21°W 87.8'; Center E-W Co. Rd. Due N. 10'

1977 – MDNR Survey Map – Plan No. R-5-I-I – Carl F. Roser, P.S.#12028 – Same info as above. Show bearings and distances North and West.

B. Description of corner evidence found and/or method applies in restoring or re-establishing corner:

E4 - 1/2 Corner common to sections 8 & 9, T30N,R06W

MDNRE Forester Ken Phillips found 1 ½" pipe, 24" long with DNR alum cap lying on ground on the South side of E-W Co. road near vicinity of the position of the corner. I reset corner per 1977 MDNR survey map by Carl F. Roser, P.S.#12028, using record bearing and distances from the C ½ corner and CE 1/16 corner to E4. Set 5/8"x34" rebar and drove fd. DNR mon. over rebar. Accepted monument as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E4 - 1/4 Corner common to sections 8 & 9, T30N,R06W

5/8"x34" rebar inside 1 1/2"x 24" pipe and 4" dia. Alum. DNR cap

Wit: \*N60°E 61.03' to set N&T on SE side 24" Sugar Maple S05°E 46.44' to set N&T on W side 10" Elm S70°W 32.62' to set N&T on S side 7" Elm N15°W 31.00' to set N&T on E side 18" Sugar Maple North 10' to centerline E-W gravel Co. road Set Blue Carsonite Post 1' South

\* Previous recorded witness.

Surveyor's Michigan License No.: 33981

CARL
KHSKILA
LAND
SURVEYOR
No.
33981

7-15-10