
LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

5. Private Claims

Baraga	Located In:	Corner Code #
(County)	•	
1. Public Land Survey	T 48N R 32W T R	G5 (GCDB 400500)
 Property Controlling in Section Miscellaneous Property in Sec. 	S 9 T 48N R 32W S T R S T R S T R S T R	1 (GCDB 320600)
4. Lot No. , Rec	orded Plat	

Register of Deeds Stamp & File Number

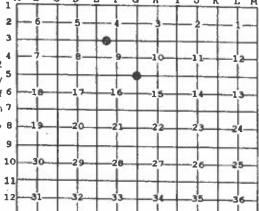

1, Stephan J. Szyszkoski, in a field survey on 06/11/14 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of 6 a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with 7 the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, 8 re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- (G5) Corner common to Sections 9-10-15-16. 1957 Remonumented in the original position by Billy D. Buckler RLS as determined from stump of Y.Birch BT. Set 1"ID I.pipe with 4" brass cap. 10" W.Pine N75°E 41 links, 9" Soft Maple S14°W 48 links. 1998 the undersigned recovered the 1957 monument in good condition at record bearing and distance from the two 1957 NBTs. New witnesses: 12" W.Spruce N18°E 20.9', 6" Maple N29°W 19.9'.

(1-Sec. 9) West 1/16 corner between Sections 4 and 9. 1975 - Established and monumented by K.L.Sackett RLS midway and on the Section line between Section and 1/4 corners. Set 1"IDx36" I.pipe with 4" aluminum cap. 7" Spruce S60°E 30.5', 5" Cherry N42°E 10.9'.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- (G5) Recovered the 1957 monument in good condition and at record bearing and distance from the 1957 NBT 9" Maple S14°W 48 links, and the 1998 NBT 6" Maple N29°W 19.9'. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.

(1-Sec. 9) Found the 1975 monument in good condition, substantially at the record position, and at record bearing and distance from the dead stub remains of the BT Cherry N42°E, scribing visible. Accepted the monument as a careful and faithful establishment of the position of the corner. See LCRC for F3, recorded this date, for information about corners on the line between Sections 4 & 9.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G5) Found 1"ID I.pipe with 4" brass MI Dept. of Conservation cap. Set measuring nail with MDNR tag in the side of:

11" Maple S21°W 31.6' overgrown blazes (1957 NBT)

6" Maple N30°W 20.0' scribing visible (1998 NBT)

6" Maple N55°E 16.55' mrkd "S10 NBT"

6" Maple S47°W 14.35' "S16 NBT"

Sq'd cedar post adjacent.

E= 7900032.787 N= 198763.913

(1) Found 1"ID I.pipe with 4" alum. State of Michigan cap. Set measuring nail with MDNR tag in the side of:

the side of:

3" Maple N64°E 8.4' mrkd "1/16S BT"

4" Maple S65°E 7.6' do

5" Balsam South 13.6' do

4" Balsam S85°W 8.85' so

Sq'd cedar post adjacent.

E= 7898854.521 N= 200368.548

Bearings are magnetic. Coordinates are MCS83 in meters (NAD83(2011) Datus Coord. Ref.=NGS PID RL1468: N= 199449.721 m. E= 7900600.011 m.

Coord. Ref.=NGS PID RL1468: N= 199449.721 m. E= 7900600.011 m

Surveyor's Michigan License No.

Signed by

For the Michigan Department of Natural Resources, Forest Resources Division

Date 06/18/2014

FORM APPROVED BY MICHIGAN STATE BO.

SI CES DIVISION

No. 33986 KEESHALL SUME (085) 14728, 1971 4 A N D S Varia Friay 14, 1975 Keyised Jan., 1983

STEPHAN J

SZYSZKOSKI

LAND

SURVEYOR

Revised Oct., 1995