

SURVEY &  
REMONUMENTATION

APR 24 1995

LIBER 2 PAGE 25

COMMISSION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
BENZIE COUNTY  
RECORDED

29 DEC 94 4:41 P.M.

NICHILLE R. GRAY  
REGISTER OF DEEDS

For corners in

Benzie

(County)

Located In:

Corner Code ##

1. Public Land Survey

T 26N R 16W

K-7

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling  
in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

Property in Sec.

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Register of Deeds Stamp & File Number

I, John B. Smendzuik, in a field survey on December 15, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

K-7: G.L.O. set post - 30" Hemlock S40°E 20.46'; 12" Sugar N59°W 27.06'. 1896 - Frank Haswell, Surveyor's Record No. 1, Page 160, found old witness stump and planted big stone with point up and small stones around it. Haswell - Surveyor's Record No. 2, Page 122, drove 1 1/2" iron pipe from original witnessess, "See old record". 1963 - Harold R. Bruning found 1/2" x 24" iron pipe inside a old 1 3/4" iron pipe. Replaced irons found with aluminum Benzie County Cap and pipe in monument box and recorded in old surveyor's corner record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


K-7: Found badly corroded Benzie County Aluminum Cap and Pipe in monument box in centerline of 'T' intersection.

Ratified by Peer Group  
In accordance with P.A. 345

Chairman

Date

12/19/94

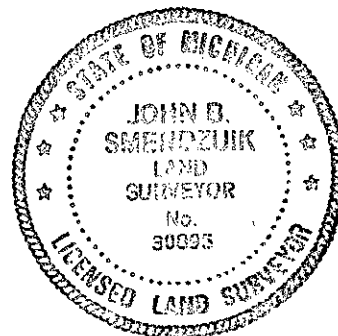

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-7: Replaced Aluminum Benzie County Cap and Iron with 3" ø concrete monument with Benzie County Remonumentation Program Brass Cap.

6" Aspen N64°E 36.24'

8" Jack Pine S41°W 56.08'

Power Pole S64°W 71.54'

Twin 14" and 10" Cherry N55°W 45.37'

Note: All measurements made to double headed nail with brass tag stamped B.C.R.P.

Signed by

Date

Surveyor's Michigan License No.

30895