

SURVEY & REMONUMENTATION

FEB 23 2001

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 Chippewa County Remonumentation Corner

For corners in **SECTION**

Chippewa County Located in: Corner Code #

1. Public Land Survey T44N R1W G-11
T R
T R
T R

2. Property Controlling S T R
in Section S T R

3. Miscellaneous S T R
Property in Sec. S T R

4. Lot No. , Recorded Plat

5. Private Claims

\$7.00 LAND CORNER

\$2.00 MSSR

2 FEB 2001 3:30:59 PM Receipt #1103

RECEIVED FOR RECORD

CHIPPewa COUNTY - STATE OF MICHIGAN

SHARON H. KENNEDY, REGISTER OF DEEDS

Book 11 Page 177

I, Keith R. Waters, in a field survey on November 10, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-11 Corner Common to Sections 27, 28, 33 & 34, T44N, R1W.

1845 - Original corner established by James H. Mullett.

Witnesses: Tamarack 12, N61°W 38 links - Cedar 8, N50°E 19 links.

1896 - Chippewa County Surveyor Frederick H. Brown, RLS 944. Notes for Section 33 indicate that that "the corners in this section are those as made by Kenworthy and no original corners to be found when I came there in 1896."

1991 - Keith R. Waters, P.S. 33142, LCRC Liber 7, page 345, Chippewa County corner records. Found a ¾" square iron at intersection of 2 track roads north, south, east, and west. Type of monument is consistent with others in the area. Witnesses:

10" Aspen, S38°W 85.60'

6" Aspen, N32°E 42.70'

3" Aspen, EAST 53.13'

Center of South End of CMP Culvert, S69°W 38.45'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found a ¾" square iron as called for in the above mentioned 1991 LCRC. The only remaining witness object is the aspen bearing tree to the northeast. Placed a plastic Chippewa County Remonumentation cap on the found iron and established additional witness objects.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found a ¾" square iron at the corner location, which falls in the centerline of a north-south 2 track road, 7'± north of the centerline of an east-west 2 track road. Placed a plastic Chippewa County Remonumentation cap on the found iron.


Witnesses:

Nail and plastic witness tag #33142 in blazed 10" Aspen, N24°E 42.62'

Nail and plastic witness tag #33142 in blazed 4" Elm, N72°E 42.88'

Nail and plastic witness tag #33142 in Corner Fence Post, S46°E 48.89'

Nail and plastic witness tag #33142 in blazed 4" Aspen, S70°W 88.42'

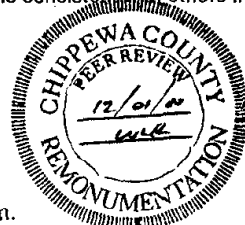

Signed by Keith R. Waters

Date 12-29-00

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995