

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Chippewa

(County)

Located In:

Corner Code #

**1. Public Land Survey**

T 45N R 2W A5

T R

T R

T R

**2. Property Controlling in Section**

S T R

S T R

**3. Miscellaneous Property in Sec.**

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Dec 06 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**

(A5) Corner common to Sections 7-18 T45N-R02W and 12-13 T45N-R03W. 1840: Established by William Burt, Deputy Surveyor. Set post corner of Sections 12 & 13. Hemlock 10 S16W 18, Maple 12 N8W 23. 1849: Bearing trees by Harvey Mellen, Deputy Surveyor: Y. Birch 12 S72E 10, Hemlock 10 N51E 52. 2000: Corner described by R.Bischer RLS 22428 as: found 1" shaft. N72W 38.10' 12" Maple old wit., N07W 27.40' 24" Oak o.w., S59E 15.48' 10" Maple o.w., S12W 14.02' 7" Maple new wit., North 34' trail.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(A5) The original post and accessories were not recovered. Recovered a 1" dia. drill rod, set firmly, in good condition, at record bearing and distance from Mr. Bischer's witnesses. Distances east and south to adjacent corners check well with Mr. Bischer's measure and the GLO record. Distance to recorded town corner is 69 feet shorter than GLO record but the bearing is only 04'30" west of true north. Accepted the drill rod as the best evidence of the location of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(A5) Replaced drill rod with 1" IDx36"

Iron pipe with 4" dia. alum. MDR cap.

Blazed and scribed the following:

18" Oak N02W 27.5' "S12 N8T"

12" Maple N67W 38.2' do

8" Maple S16W 14.0' "S13 N8T"

10" Maple S54E 15.45' "S18 N8T"

Center of E-W trail 34' north.


Placed the drill rod and a squared cedar

post adjacent. Bearings are magnetic.

Dist. to nails with tag #22428.

Signed by Stephan J. Szyszkoski

Surveyor's Michigan License No. 33986

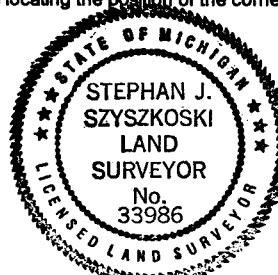

Date 2/14/02

For the Michigan Department of Natural Resources - Office of Property Management