SURVEY & REMONUMENTATION

FEB 23 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Chippewa County Remonumentation Corneg7.00 LAND CORNER

For corners in

Chippewa County	Located in:			Corner Code #
1. Public Land Survey		T47N T T T	R2E R R R	G-3
in Section	S :	T T	R R	
	s ·	T	R R	

\$2.00 MSSR 9 FEB 2001 10:47:27 AM Receipt #1201 RECEIVED FOR RECORD CHIPPENA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

800K 11 PAGE 241

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5. Private Claims

I, Larry R. Rogers, P.S., in a field survey on December 07, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

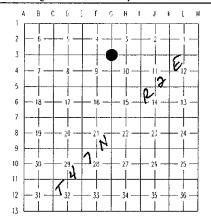

A. Description of original monument and accessories and/or subsequent restoration:

(G-3) Section Corner common to Sections 3, 4, 9 and 10, Township 47 North, Range 2 East.

The original corner post was placed in 1845 by John Mullett. County Surveyor Fred Brown "saw cross" in 1845 by John Mullett. PEWA CO and put in post". Same notes refer to North - South road.

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G-3) Section Corner common to Sections 3, 4, 9 and 10, Township 47 North, Range 2 East.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Found no evidence of original corner position, any subsequent restoration, or North – South road. Re-established corner position by double proportionate measurement between the Southwest corner of Section 4, the County Remonumentation of Section 4, the County Remonumentation Program. B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

corner position by double proportionate measurement between the Southwest corner of Section 4, the Southeast corner of Section 3, the Northwest corner of Section 3 and the East 1/4 corner of Section 9. The distance to the Southwest corner of Section 4 is 5289.38 feet (GLO= 5286.6 feet); to the Southeast corner of Section 3 is 5297.3 feet (GLO = 5294.52 feet); to the Northwest corner of Section 3 is 5108.82 feet (GLO = 5280 feet); and to the East 1/4 corner of Section 9 is 2554.41 feet (GLO = 2640 feet).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: (G-3) Section Corner common to Sections 3, 4, 9 and 10, Township 47 North, Range 2 East.

Corner is a 3/4" x 24" rebar with stamped aluminum remonumentation cap set at the Northwest base of a 12" Sugar Maple.

Witnesses:

10" Yellow Birch N36°W 50.81 feet 8" Sugar Maple N26°E 26.34 feet 12" Sugar Maple N81°E 18.33 feet S34°W 8" Yellow Birch 56 29 feet Corner falls on East - West brush line.

ARRY R. ROGERS and Surveyo NO. 29251 SED LAND SU

Bearings are magnetic compass bearings. All distances are to a nail and tag in the side of the witness object unless otherwise noted.

Signed by

Larry R. Rogers, P.S. Surveyor's Michigan License No. 29251

29 DEC 200

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
PAGE 24 REVISED JAN. 1983
REVISED JAN. 1983
REVISED JAN. 1983

c:\word\nls\cornerforms\2000 chippewa\t47nr2e g-3.doc