

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Re-Mondeliev2, Page
CERTIFICATE

Huron
(County)

Corner Code #

STATE OF MICHIGAN
HURON COUNTY
RECORDED

29 NOV 2000 11:21 AM

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- | | | | |
|---|---------|---------|---------------------------------------|
| 1. Public Land survey: Sebewaing | T 15_N | R 9_E | A-7 ✓ |
| | T _____ | R _____ | A-8 _____ |
| | T _____ | R _____ | SURVEY &
DOCUMENTATION |
| | T _____ | R _____ | |
| 2. Property Controlling
in Section | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 3. Miscellaneous
Property in Sec. | S _____ | T _____ | R _____ |
| | S _____ | T _____ | R _____ |
| 4. Lot No. _____, Recorded Plat _____ | | | JAN 19 2001 |
| 5. Private Claims | | | SECTION |

I, James T. Meek, in a field survey on October 1, 2000

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
Original survey, West Bdy. T15NR9E, 1835, Harvey
Parke D.S.

A-7 Corner of Sections 18, 19
Post
W. Oak 16", S42°E, 2.04 chains
W. Oak 20", N75½°E, 3.59 chains

County Surveyor's Record: none
Recorded Surveys: L1, P53; L1, P425
LCRC: none

A-8 West 1/4 Corner of Section 19
Not monumented

County Surveyor's Record: none
Recorded Surveys: L1, P425
LCRC: none

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-7 Corner of Sections 18, 19

A-8 West ¼ Corner of Section 19

Found 1" pipe
Accepted as best available evidence of
the original corner position
Set 1/2" iron w/cap #39089 at
intersection with line from M-5 to M-6,
T15NR8E

Found ¾" pipe
Accepted as best available evidence of the
original corner position
Set ½" iron w/cap #39089 at intersection
with line from M-6 to M7, T15NR8E

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-7 Corner of Sections 18, 19

A-8 West ¼ Corner of Section 19


1/2" iron w/cap #39089
From which:
Tag in Ash bears N10°E, 49.1'
¾" pipe bears S15°W, 10.8'
1" pipe bears West, 1.6'
Tag in 8" Ash bears N15°W, 36.1'
M-5, T15NR8E Corner of Sections 12 & 13,
bears N0°24'43"W, 40.85'
M-6, T15NR8E East ¼ corner of Section
13, bears S0°24'43"E, 2629.30'

1/2" iron w/cap #39089
 From which:
 Tag in 5" Ash bears N1°E, 42.3'
 Tag in 10" Elm bears N40°E, 60.4'
 1/4" pipe bears West, 5.44'
 1/4" iron bears N40°W, 65.6'
 M-6, T15NR8E East 1/4 corner of Section 13, bears
 N0°011'53"W, 44.67'
 M-7, T15NR8E Corner of Sections 13 & 24, bears
 S0°011'53"W, 45.43'

Signed by _____

Surveyor's Michigan License No. 39089

APPROVED AT PEER BOARD MEETING 11-02-00 RLB

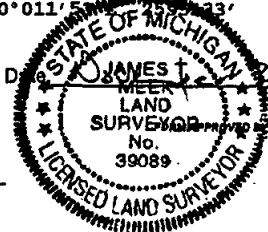

APPROVED BY MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 1915
REVISED MAY 14, 1915
REVISED JAN. 1915
REVISED OCT. 1915