

## 2000 REMONUMENTATION

*Re-Monumented, Page*

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For Corners in

Huron  
 (County)

Located in:

Corner Code #

 STATE OF MICHIGAN  
 HURON COUNTY  
 RECORDED

29 NOV 2000 11:21 AM

 FRANCES L. HOLDWICK  
 REGISTER OF DEEDS
1. Public Land survey: Sebewaing T 15\_N\_ R 9\_E

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

T \_\_\_\_\_ R \_\_\_\_\_

2. Property Controlling  
in Section

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

3. Miscellaneous  
Property in Sec.

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

A-7 \_\_\_\_\_

A-8 ☒
 SURVEY &  
 REMONUMENTATION

JAN 19 2001

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

SECTION \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, James T. Meek, in a field survey on October 1, 2000,

do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules thereof as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

## A. Description of original monument and accessories and/or subsequent restoration:

Original survey, West Bdy. T15NR8E, 1835, Harvey Parke D.S.

A-7 Corner of Sections 18, 19

Post

W. Oak 16", S42°E, 2.04 chains

W. Oak 20", N75½°E, 3.59 chains

A-8 West ¼ Corner of Section 19

Not monumented

County Surveyor's Record: none

Recorded Surveys: L1, P53; L1, P425

LCRC: none

County Surveyor's Record: none

Recorded Surveys: L1, P425

LCRC: none

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

## B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-7 Corner of Sections 18, 19

Found 1" pipe

Accepted as best available evidence of the original corner position

Set ½" iron w/cap #39089 at

intersection with line from M-5 to M-6, T15NR8E

A-8 West ¼ Corner of Section 19

Found ¾" pipe

Accepted as best available evidence of the original corner position

Set ½" iron w/cap #39089 at intersection

with line from M-6 to M7, T15NR8E

## C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-7 Corner of Sections 18, 19

½" iron w/cap #39089

From which:

Tag in Ash bears N10°E, 49.1'

¾" pipe bears S15°W, 10.8'

1" pipe bears West, 1.6'

Tag in 8" Ash bears N15°W, 36.1'

M-5, T15NR8E Corner of Sections 12 &amp; 13,

bears N0°24'43"W, 40.85'

M-6, T15NR8E East ¼ corner of Section

13, bears S0°24'43"E, 2629.30'

A-8 West ¼ Corner of Section 19

¾" iron w/cap #39089

From which:

Tag in 5" Ash bears N1°E, 42.3'

Tag in 10" Elm bears N40°E, 60.4'

¾" pipe bears West, 5.44'

¾" iron bears N40°W, 65.6'

M-6, T15NR8E East ¼ corner of Section 13, bears

N0°01'53"W, 44.67'

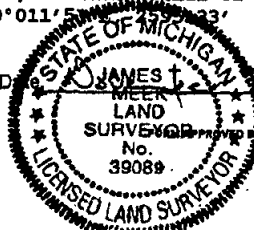
M-7, T15NR8E Corner of Sections 13 &amp; 24, bears

S0°01'53"W, 2629.30'

Signed by

Surveyor's Michigan License No. 39089

D

APPROVED AT PEER BOARD MEETING 11-02-00 R&B
 MICHIGAN BOARD OF LAND SURVEYORS, JAN. 28, 19  
 REVISED MAY 14, 19  
 REVISED JAN. 19  
 REVISED OCT., 19