

SURVEY & REMONUMENTATION

FEB 21 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

COMMENCING YEAR 2000
RECEIVED FOR RECORD
IRON COUNTY, MICHIGAN

00 DEC 22 PM 3: 25

L.C. Records: L. 8, P. 309
Richard L. Pisoni
REGISTERED LAND SURVEYOR

Register of Deeds Stamp & File Number

For corners in

<u>Iron</u> (County)	Located in:	Corner Code #
1. Public Land Survey	T <u>43N</u> R <u>31W</u>	<u>C.D-11e</u> <u>(006)</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

4. Lot No. , Recorded Plat
5. Private Claims

East Meander Corner Between Sections 29 and 32, T43N, R31W

I, Gary L. Pisoni, in a field survey on December 11, 2000 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Original corner established on July 16, 1849 by John Burt, U.S. Deputy Surveyor.

Original Corner; Wood Post

Original Bearing Trees:

Yellow Pine	14"	N 73° E	37 links (24.42 feet)
Yellow Pine	14"	S 34° E	36 links (23.76 feet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original B.T.s found.

Corner located on the East bank of the Michigamme River and is 3' from waters edge.

Restored the corner position by single proportionate measurement and set a witness corner meander corner on line between the Northwest Section corner and the North Quarter corner of Section 32.

Corner record research on file with County Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

At the corner position, set a 5/8" diameter by 20" long rebar pin with a 3" diameter aluminum cap stamped as follows: Iron County Remonumentation, T43N, R31W, W.C.M.C., S- 29, S-32, N 89° 38'03"W, 8.68 feet, 2000, RLS 27457 from which I established the following new blazed and scribed bearing trees: (all measurements taken to a nail in side of tree)

Cedar	13"	S 28° E	39.50 feet
W.C.M.C.		N 89° 38'03"W	151.77 feet
Steel sign post		N 68° W	0.90 feet


00-077

Signed by Gary L. Pisoni

Date 12-19-2000

Surveyor's Michigan License No. 27457

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

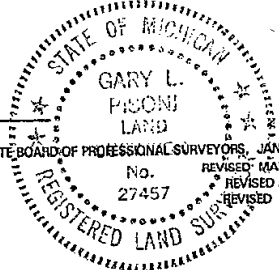

LIBER

8 PAGE 309