

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Iron (County)	Located In:	Corner Code #
1. Public Land Survey	T 43N R 33W	MC South of K3
	T R	
	T R	
2. Property Controlling in Section	S 12 T 43N R 33W	SMC S. of #4
	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Stephan J. Szyszkoski, in a field survey on MC 08/11/2011 SMC 08/08/2011 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(MC South of K3) Meander corner on the north bank of the Paint River on the Section line between Sections 11 and 12. 1851 - Established by Guy H. Carleton Deputy Surveyor. S17'E corrected between Secs 11 & 12 ...39.20 Intersect left bank of River and set meander post. B.Ash 9" N65E 26 links. ... 80.04 Set post corner of Sections 11, 12, 13, 14. 2007 - Steve Applekamp PS 43045 placed monuments along the line between Sections 11 and 12 for a survey recorded in L.2, Page 306, Iron County Records.

(SMC S. of #4) Special Meander Corner on the West 1/16 line of Section 12, south of 1/16 corner #4, between Government Lots 3 and 4. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(MC South of K3) The original post and accessories were not recovered. Found a 5/8" rebar with red plastic cap stamped "Applekamp MI43045 WI12402" on the line between Section corners K3 and K5 and 2550.03' (2550.05' Applekamp rec.) south of monumented K3. As the mile K3-K5 measures 5342.17', the proportionate distance for the MC is 2616.36' south of K3. Therefore this monument is a Witness Corner to the reestablished MC, 66.33' north of the reestablished position for the Meander corner.

(SMC S. of #4) Established the corner on the West 1/16 line of Section 4 612.00' south of the NW1/16 corner of Section 4 and on the northerly bank of the Paint River. The direction of the 1/16 line was determined at mean bearing of the West line of Section 12 and the N-S 1/4 line of Section 12.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


(MC) Fd. 5/8" rebar with cap #43045  
Set measuring nail with MDNR tag in the side of:  
19" Cedar S85E 16.9' with old blaze  
10" Ash S61E 6.6' do  
10" Ash N39W 28.6' mrkd "SMC BT"  
8" Sugar N15W 23.9' do  
Set sq'd Cedar post adjacent.  
Bearings are magnetic.

(SMC) Set 1"IDx32" I.pipe with 4" alum. MDNR cap.  
Set measuring nail with MDNR tag in the side of:  
9" W.Spruce N61E 23.2' (slope) mrkd "SMC BT"  
8" W.Ash S68E 18.8' do  
5" W.Spruce S50W 5.95' do  
4" B.Ash N75W 10.0' do  
Set sq'd Cedar post adjacent.  
Bearings are magnetic.

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 09/21/2011

For the Michigan Department of Natural Resources, Forest Management Division

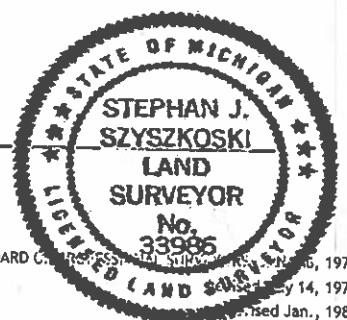

16731

16721