

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Iron

(County)

Located in:

Corner Code #

1. Public Land Survey

T 44N R 31W

L7

2. Property Controlling
in Section

S 25

T 44N R 31W

2

3. Miscellaneous
Property in Sec.

S

T R

S

T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

2 Jun 30 1997

L7 Jun 25 1997

I, Stephen J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

(L7) Quarter corner common to Sections 13-24. Corner established in 1849 by John Burt: "Set sugar Qr. Section Post. Sugar 6 N12W 13, Y. Birch 6 S64W 11". Found no subsequent record.

(2-Sec. 25) East 1/16 corner between Sections 24-25. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(L7) Original post and accessories not recovered. Found no acceptable evidence of the position of the original corner on the ground. Reestablished the corner midway and on a line of mean true bearing between Section corners 2645.85' East and West, being proportionate to the original record. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office, MDNR.

(2-Sec. 25) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a line of mean true bearing between Quarter corner 1317.26' West and Section corner 1317.26' East. At the position for the corner, I placed a 1" I.D. x 32" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office, MDNR.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(L7) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

10" N. Spruce N51E 43.65' 1/4S NBT

30" N. Pine S96E 74.0' 1/4S NBT

24" N. Pine S72W 69.1' 1/4S NBT

9" N. Pine N64W 47.7' 1/4S NBT

Placed a squared spruce post adjacent.

Centerline of a N-S 2-track is 10' West.

Bearings are magnetic.

(2) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

8" Maple N24E 48.3' 1/16S BT


20" Maple S68E 5.9' 1/16S BT

22" Y. Birch S24W 32.0' 1/16S BT

7" Maple N56W 4.4' 1/16S BT

Set squared maple post adjacent.

Bearings are magnetic.

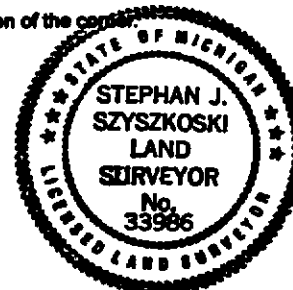

Signed by

Stephen J. Szyszkoski

Surveyor's Michigan License No.

33986

Date

Sept. 8, 1997

For the Michigan Department of Natural Resources - Forest Management Division