

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

KALKASKA

(County)

Located In:

Corner Code #

2000 REMONUMENTATION

1. Public Land Survey

T 27N R 6W

E-4

2. Property Controlling
in Section

S

T

R

3. Miscellaneous
Property in Sec.

S

T

R

S

T

R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

**SURVEY &
REMONUMENTATION**

FEB 26 2001

SECTION

I, EUGENE FARRIER, in a field survey on December 12, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-4: 1/4 Cor. Common to Secs. 8 & 9, T27N-R6W, Excelsior Township

1852, G.L.O. Resurvey, by George H. Cannon, set post for corner; Hemlock 18", N52°E, 23 Lks; Sugar 6", S74.5°W, 8 Lks

1895, Surveys, by E. B. Dinnie, found original accessories as set iron perpetuated

1874, LCRC, by L. Gerschbacher, Liber 1, Pg 300 A, found 1/4" iron bar, telephone pole, West, 33.15'; 12" Maple, N18°W, 105.50'

1981, Survey, by W.B. Batzer, found iron & cap; power pole, S58°E, 39.11'; 16" Maple, N12°W, 106.65'; telephone pole, West, 35.15'

1984, Survey, by E. Farrier (Co. Surveyor), found 1/2" iron in centerline road and on E-W fence line; found PK nail in power pole, S60°E, 39.12'; found nail in power pole, S85°W, 33.23'; set nail in power pole, S67°W, 40.52'

1989, LCRC, by P.R. Stout, Kalkaska Co. Rd. Comm, found 3/4" iron in mon box; 4" R. Pine, N66°E, 75.96'; fence post, N47°W, 43.36'; power pole, N89°W, 33.20'; power pole, S58°E, 39.10'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-4: 1/4 Cor. Common to Secs. 8 & 9, T27N-R6W, Excelsior Township

Found 5/8" iron rod in mon box, in centerline of Co. Rd. 571 (1.1' deep), raised with 5/8" iron rod & brass remon cap. No G.L.O. witnesses were found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-4: 1/4 Cor. Common to Secs. 8 & 9, T27N-R6W, Excelsior Township

Found 5/8" iron rod in mon box, in centerline of Co. Rd. 571 (1.1' deep), raised with 5/8" iron rod & brass remon cap.

N37°E, 102.55', 14" Spruce, set nail & tag South side

S60°E, 39.02', power pole, set nail & tag over old spike

West, 33.15', power pole, found old spike

N15°W, 105.10', 22" Maple, set nail & tag East side

Kalkaska County Peer Group accepted the above monument as the best available evidence of the position of the original corner.

Attested by Peer Group

P.A. 345 - 1990 Kalkaska County

Chairman


Date

2-14-01

Signed by

Surveyor's Michigan License No. 24594

Date 2-15-01

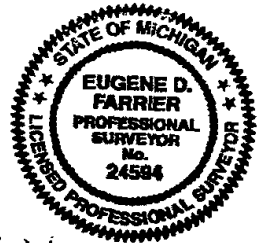

Kalkaska County Joan Hall, Register

3026831

Page: 1 of 1

02/15/2001 10:26A

REMON

LB: 6 PG: 160

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14, 1976

REVISED JAN., 1983

REVISED OCT., 1998