

JAN 22 2001

Filed under Remonumentation Act 345 of 1990

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

SECTION




LIBER 1 PAGE 424

For corners in

Lenawee
(County)

Located In:

Corner Code #

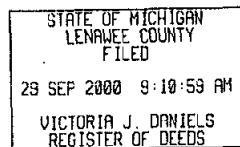

1. Public Land Survey T-6-S R-2-E M-2
 T _____ R _____
 T _____ R _____
 T _____ R _____
2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____
3. Miscellaneous S _____ T _____ R _____
 Property in Sec S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
5. Private Claims _____

I, Glenn E. Richard in a field survey on August 22, 2000
do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned
in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the
current manual of survey instructions of the United States Department of the Interior, Bureau of Land
Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5
above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a
Court of Law; established, re-established, monumented, re-monumented, recovered, found as
expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded
on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. 1824 Harvey Parke D.S. Set 1/4 Sec. post B. Ash 12 S 13 E 8 Maple 14 N 7 W 20

Could not find any information on this corner prior to 1975

1975 Werner Sommer re-established the corner by setting a 3/4" iron pipe on a line between the monumentation found
at A-1 & 2 T6S R3E and in line of fence to west which checked the deed distance to the next fence north running west
and described in a deed recorded Nov. 8, 1872 in Liber 98 on Page 619 (40 rods and 2 links) and recorded it in
Liber 3, Page 155

1980 I found iron pipe 2' deep and raised with 3/4" X 18" iron pipe

1986 Kenneth Suydam found iron pipe

1993 Werner Sommer found iron pipe

1995 Michael Bartolo found 3/4" iron pipe & recorded it in Liber 5, Page 266

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

August 22, 2000 Kevin Pickford found 3/4" X 16" iron pipe over 3/4" X 24" iron pipe and set a 30" Harrison Monument
stamped P.S. 13040

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

30" Harrison Monument stamped P.S. 13040 6" deep and is accepted as the best available evidence
of the position of the original corner

Fd dbl hd nail and disc in 9" Elm N 30° E 36.77

Fd dbl hd nail and disc in 21" Ash N 55 E 27.69

dbl hd nail & re-mon tag in E.P. West 262.16

SE corner of Hse. #6614 N 15° W 298.14

A-2 T6S R3E South 464.65

Centerline of gravel road 5.5± West



Ratified by Peer Group in accordance with P.A. 345 Co. Rep. Glenn E. Richard Date August 8, 2000

Signed by Glenn E. Richard Date Sept. 25, 2000
Glenn E. Richard

Surveyor's Michigan License No. 13040