

SURVEY &
REMONUMENTATION

JAN 21 1999

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Mackinac County Remonumentation Corner

For corners in

Mackinac

Located In:

Corner Code #

1. Public Land Survey

T 43N R 1W

E-1

T R

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Larry R. Rogers in a field survey on December 21, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(E-1) Northeast Corner of Section 5, Township 43 North, Range 1 West. (Closing Corner)

The original corner was placed by James Mullet in 1845, 20 links East of the standard Section corner common to Sections 32 and 33, Township 44 North, Range 1 West. In 1983, William L. Karr re-established corner position by "proportionate measurement on line between the Southeast and Southwest corners of Section 33, Township 44 North, Range 1 West", and filed a L.C.R.C. in the Mackinac County Corner Records. Corner was subsequently recovered 13.38 feet East of standard Section corner but was removed by Chippewa County Road Commission paving project.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E-1) Northeast Corner of Section 5, Township 43 North, Range 1 West. (Closing Corner)

This corner is being perpetuated as part of the Mackinac County Remonumentation Program.

Re-established corner position on-line between Southwest corner and South 1/4 corner of Section 33, Township 44 North, Range 1 West, and 13.38 feet East of Southwest corner of Section 33.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E-1) Northeast Corner of Section 5, Township 43 North, Range 1 West. (Closing Corner)

Corner is a 3/4" x 24" iron with plastic "County Remonumentation" cap set in new monument box in the centerline of Townline Road and 4 feet West of the centerline of a seasonal road to the South.

Witnesses:

Utility Pole (158)

N88°E 188.77 feet

Fence Post

S39°E 70.31 feet

Corner Fence Post

S37°W 55.81 feet


"V" notch in top C.M.P.

N35°W 31.89 feet

Standard Section Corner

West 13.38 feet

ACCEPTED BY THE MACKINAC COUNTY
SURVEY PEER GROUP AS THE
OFFICIAL CORNER UNDER P.A.
345 OF 1990 AT A MEETING
HELD ON 12-04-98 NEH

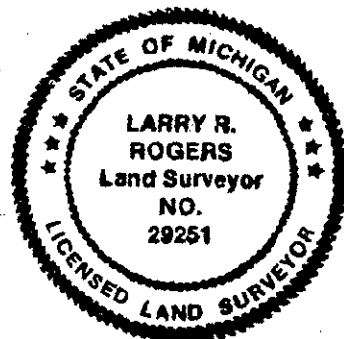

Signed by _____ Date 24 Dec 1998

Surveyor's Michigan License No. 29251

NOTE: Bearings are magnetic compass bearings not corrected for declination. Distances are to a nail in side of witness object unless noted.