

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

56

For corners in
Mackinac

(County)

Located In:

Corner Code #

1. Public Land Survey

T 44N R 11W H5

T R

T R

T R

2. Property Controlling
in Section

S 10 T 44N R 11W 3

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

H5 May 16 1996

3 Apr 11 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5			4		3		2		1	
3													
4	7		8			9		10		11		12	
5													
6	18		17			16		15		14		13	
7													
8	19		20			21		22		23		24	
9													
10	30		29			28		27		26		25	
11													
12	31		32			33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

(H5) Quarter corner common to Sections 10-15. Corner restored in 1972 by Billy D. Buckler, RLS. Corner monumented by a 1" pipe with a 4" aluminum cap and the following: 14" Hard Maple S46W 18.2', 28" Hard Maple N63E 49.5'

(3-Sec. 10) North 1/16 corner between Sections 9-10. Corner established in 1987 by Gerald L. Wiggins, RLS, midway and on a straight line between Section corner north and Quarter corner south. Corner monumented with a 1" iron pipe capped with a 4" aluminum tablet (DNR monument) and the following: 6" Maple S60E 16.9', 6" Maple N38W 25.4', 8" Beech N05W 24.9', 5" B. Ash N85E 26.6'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H5) Found the 1972 monument as described, in good condition, and at record bearing and distance from the 1972 witnesses. Left the monument in place, marked new top blazes on the witnesses, and also placed measuring nails in them. Marked two new accessories as described below. Corner re-witnessed by T. Stark and D. Lampela, Newberry.

(3-Sec. 10) Found the 1987 monument in good condition and at record bearing and distance from Wiggins' witnesses. Determined the monument to be 0.39' north and 0.37' east of Wiggins' intended position, and accepted the monument as a careful and faithful determination of the position of the corner. Left the monument in place, marked new top blazes in the 1987 trees, and placed measuring nails in them. Corner re-witnessed by T. Stark and D. Lampela, Newberry.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H5) Found 1" pipe with 4" MDNR cap.
Blazed, scribed, and set measuring nails
in the following:

18" H. Maple S46W 18.7' 1/4S"

32" H. Maple N63E 50.65' 1/4S"

10" Maple West 18.3' 1/4S NBT"

5" Cherry N35E 73.5' 1/4S NBT"

Placed a squared and scribed cedar post
adjacent. Bearings are magnetic.

(3) Found 1" pipe with 4" MDNR cap.
Blazed and set measuring nails in the
following 1987 witnesses:


7" Maple S60E 17.2'

7" Maple N38W 25.9'

10" Beech N05W 25.45'

7" Ash N85E 26.85'

Placed a 5" cedar post adjacent.
Bearings are magnetic.

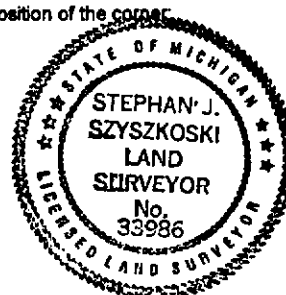

Signed by

Stephan J. Szyszkoski

Date

6/25/96

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division