

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Manistee (County)

Located In:

Corner Code #

1. Public Land Survey T21N R14W MC North of G 9
T R
T R
T R Other #4
2. Property Controlling S T R
in Section S T R
3. Miscellaneous S T R
Property in Sec. S T R
4. Lot No. , Recorded Plat
5. Private Claims

REGISTER'S OFFICE
MANISTEE COUNTY
95-347 at 1:15pm
SEP - 7 1995
Deborah Six Dep.
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, Sammy S Barnett, in a field survey on May 25, 1995, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Meander corner North of G 9 sections 21 & 22 T21N R14W

1849 G.L.O. by E. H. Porter

1. 10" Yellow Pine for corner
No witnesses given

1915 S. H. Baker
No monument or witnesses
1952.48 ft. S of G 8

- 1962 Robert A. Griffin, survey technician USFS
Found 4" x 4' concrete monument, replaced it with a 6" round by 6' long concrete monument with a brass cap stamped to mark the corner.
2. Cedar 5" N57E 20.55 ft(10" boat spike & scribed)
3. SE corner cabin foundation N18W 48.25 ft.
4. Cedar post North 1.5 ft.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Meander corner North of G 9 sections 21 & 22 T21N R14W

On May 25, 1995 we found a 6" round by 5' long concrete monument with a brass cap as set by R.A. Griffin. We measured north to G 8 1908.89', GLO had 1958.22', a difference of 49.33'. We recovered an old 4" x 4' square concrete monument that has been used as the South 1/16 corner between sections 21 & 22, we measured North 1347.78' from said 1/16 corner to the 1/4 corner between sections 21 & 22. S.H. Baker in 1915 measured 1350.38' on this line. Baker gives a distance of 602.1' from the South 1/16 corner, South to the M.C., which would place the M.C. in the waters of Pine Lake a distance of 41.0' I measured 561.10'

Condition of witnesses 1. gone 2. No boat spike or scribing 3. Cabin was moved
4. Cedar post is 1.5 ft South of monument

Accepted 6" round by 5' long concrete monument as the MC North of G 9


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Meander corner North of G 9 sections 21 & 22 T21N R14W

2. OBT Cedar 8" N57E 20.5' to center of tree (no boat spike or scribing, only tree tag)
3. SE corner of a cabin foundation N35W 58.79' (cabin had been moved)
4. Cedar Post South 1.5' (very old post)
5. Red Oak 7" S55E 21.60' (Nail & Shinner # 31595 in SW side, added 60d spike)
5b. Maple 5" n53W 14.38' (Nail & Shinner # 31595 in SW side, added 60d spike)

Corner MC North of G 9 ratified by the Manistee County Peer Group according to the county plan adopted pursuant to P.A. 345 of 1990, as amended, (being the State Survey and Remonument Act, MCP 54.261 E. sec.). Date of Peer Review: AUGUST 1, 1995

Signed by Sammy S Barnett Date 9-5-95
Surveyor's Michigan License No. _____

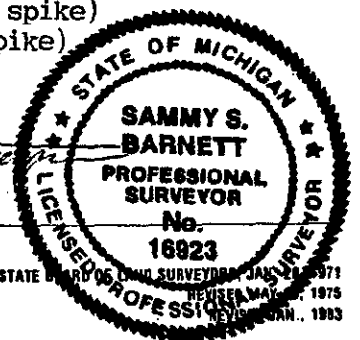

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN 21 1971
RENEWED MAY 1975
RENEWED JAN 1993