

REMON. COR. E-7, LARKIN TWP.  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Midland

(County)

Located in:

Corner Code #

513

STATE OF MICHIGAN  
MIDLAND COUNTY  
REMONUMENTATION & FILED

12/28/2000 8:44:27 AM

Register of Deeds State of Michigan  
REGISTER OF DEEDS

1. Public Land Survey

T 15N R 2E E-7

2. Property Controlling  
in Section

S T R SURVEY &  
REMONUMENTATION

3. Miscellaneous  
Property in Sec.

S T R FEB 23 2001

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

SECTION \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, RODNEY CLAYPOOL, in a field survey on August 4, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned on lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

E-7 Corner common to Sections 16, 17, 20 and 21

Survey by Glo, 1830's, set post

Survey by D. Whittier, 1963, found

Survey by M. Hunter, 1966, 1968, found ¾" pipe in monument box

Survey by J. Schafer, 1970, 1976, 1977, 1979, found ¾" pipe in monument box

Survey by Ayres Associates, 1981, 1986, 1994, 1998, found ¾" pipe in monument box

Survey by D. Ledy, 1994, found

LCRC by J. Jones, 1982, found ¾" pipe in monument box

LCRC by P. Lapham, 1983, found monument box

Sasse Estates No. 1, L-K, P-25-28.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-7 Corner common to Sections 16, 17, 20 and 21

Found ½" pipe in monument box per surveys by D. Whittier, M. Hunter, J. Schafer, Ayres Associates, D. Ledy and LCRC's by J. Jones and P. Lapham, and fits Sasse Estates No. 1 as recorded.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-7 Corner common to Sections 16, 17, 20 and 21

Set ¾" pipe and brass cap stamped Midland Co. Remon Cor PS 29241 over ½" pipe and is accepted as the best available evidence of the position of the accepted corner.

East, 32.62, concrete monument, Rec. 33.0  
N 60 Deg W, 46.02, notch in West end 72" CMP., Rec 46.0  
N 60 Deg E, 33.10, notch in East end 72" CMP. Rec 33.05  
S 60 Deg E, 71.04, nail and tag in power pole, Rec. 71.04  
Southwest, 63.28, centerline top telephone box

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5		4	3	2	1						
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

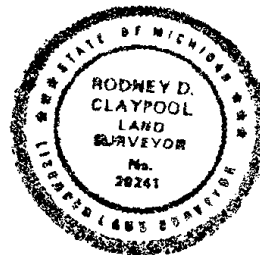

Signed by Rodney D. Claypool  
Surveyor's Michigan License No. 29241

Date 12-12-00

Form approved by Michigan State Board of Land Surveyors, Jan. 28, 1971  
Revised May 14, 1971  
Revised Jan., 1983

RECEIVED LAND CORNER  
P.A. 345 OF 1900  
MIDLAND COUNTY

12/27/00 JSC